

SONY

Dictation Products Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CCP-200 RF/D

No. 4

Subject: No Audio

Date: August 27, 1991

Symptom:
(**)


No audio on any of the channels.

Solution:

Replace blown fuses on +15V and -15V power supply lines to the Audio Board.
The fuses are located at the H1 section of the CPU Power Board as PS-201 (+15V) and PS-202 (-15V).

| REF. NO. | DESCRIPTION | PART NO. |
|----------|-----------------------|--------------|
| PS-201 | FUSE, LINK N10 (0.4A) | 1-532-605-00 |
| PS-202 | FUSE, LINK N15 (0.6A) | 1-532-679-00 |

Note: These fuses are not listed in CCP-200 Service Manual.

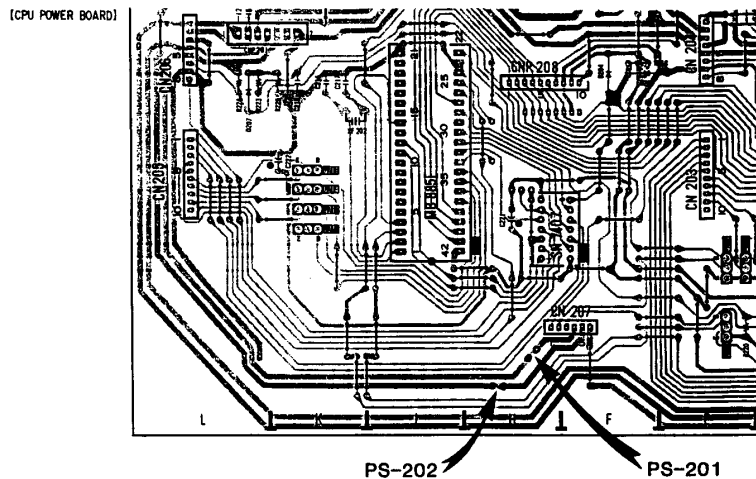

Reference: Yasu Kosuda

PRINTED IN U.S.A.
CSA-15891-1

CSA-15 Dictation