

Model: KP-57XBR10W, KP-65XBR10W**No.** 512**Subject:** Intermittent retrace lines in picture**Date:** December 6, 2000**Symptom:**
(5344)

Retrace lines may appear when the set is first turned on from a cold start for about one second.

Solution:

If the customer should complain of this symptom please perform the following circuit change on the CG Board.

Replace the resistor in the table below with the new resistor value on the CG Board.

Change GCUT to 10 in the Service mode.

Readjust the following items: G-2 adjustment, White balance, and Sub-bright all in the "Standard" picture mode.

Ref.	Description	Part Number
R7203	Chip res. 100K 1/10 Watt	1-216-097-00

Model	Serial Number Range that does not have this value change.
KP-57XBR10W	9000001-90000700
KP-65XBR10W	9000001-90000200

Note: CG boards in WRPC will be corrected to the new value resistor.

