

**SONY**

## Video/RGB Monitor Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** PVM-2030/PVM-2530

**No. 7**

**Subject:** Last Condition Memory Mis-Operation

**Date:** March 12, 1993


**Symptom:**  
(B22)

Unit fails to return to the last memory settings.

If the unit is RESET (to return to default settings) using the front Panel Controls then, powered OFF and ON again, the unit may not power up with the default settings.

**Solution:**

If this is the case, remove or cut off the pull-up resistor (10K Ohm) part of CP-101 which is connected to pin 15 (Busy Terminal) of IC-102 (CXK-1005P) on the B1-Board. This resistor is the 6th one on CP-101 (See Diagram).

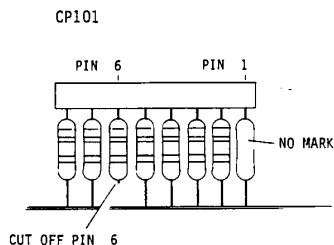

CSI-112 PVM Monitors