

VESTEL ELEKTRONİK A.Ş.	TECHNICAL CHANGE BULLETIN TEKNİK DEĞİŞİKLİK BÜLTENİ	CHANGE NO: 89
		REF NO : 284
		DATE :10.05.2001

AFFECTED MODELS: CHASSİS 11AK19P4 (2 SC, W/FAV)

START DATE : 10.05.2001

REASONS OF CHANGE:

A vertical line problem at 11 AK 19 chassis double scart with front AV models.

NOTE 1:

1. Cut the copper wire between R085 and the pin 20 of the scart SC051.
2. The cable (SAP code is 30015625) has live and shield part on it. Solder one of the live part to the pin 20 of the scart and solder other end to the leg of the C051 which besides R045.
Solder one of the shield part to the pin 21 of the scart and solder other end to the leg of the C427 which is connected to the ground.

OUT

NO	PCB CODE	VESTEL CODE	COMPONENT NAME	POSITION NUMBER	QUANTITY
1					
2					
3					
4					
5					

IN

NO	PCB CODE	VESTEL CODE	COMPONENT NAME	POSITION NUMBER	QUANTITY
1		30015625	CABLE 2P SHIELD 110MM	SEE NOTE 1	1
2					
3					
4					
5					

APPLICATION ENGINEER	APPLICATION ENGINEER CHIEF	APPLICATION ENGINEER MANAGER
-------------------------	----------------------------------	---------------------------------

V. TOKER		BEYHAN DAĞITAN
----------	--	----------------

Form Rev.No:00

Form No: 04.UMB.01