
Model: KPR-41EXR95, KPR-46EXR15, KPR-53EXR15,
KV-27XBR25, KV-27XBR25, KV-27XBR35
KV-32XBR35**No. 367****Subject: Replacment of the P1 Board****Date:** August 17, 1998**Symptom:**
(1375)

After replacing the P1 Board A-1195-051-A, there was no PIP operation. Only child picture channel numbers are displayed. The old board now subs to T99856481, which is a kit containing a new P1 board and M board. After replacing these boards there was no PIP operation.

Solution:

If the original P1 board A-1195-051-A needs to be changed the original board is no longer available. The new P1 board contains different micros. Due to these changes the replacement board can not work directly with the M board in the unit. Therefore Kit T99856481 was created. **The M and P1 Board in the kit must be replace as a pair.** Once the new M Board is installed you must go into the Service Mode and change adjustment PPLL from 0 to 1 to get PIP to work. If the M board is not changed the PPLL adjustment will not show up and no PIP will be displayed.

The kit includes:
P1 board A-1195-066-A
M board A-1306436-A

