

SONY[®]

Sony Service Company
National Technical Services
A Division of Sony Electronics Inc.
Park Ridge, New Jersey 07656

CONFIDENTIAL

Service Bulletin TV Products

CSV-1**Model:** KV-20M20, KV-20S20, KV-20S21, KV-20S30**No. 377****Subject:** No power, C609 defective**Date:** October 21, 1998**Symptom:**
(1110)

Unit had no power. C609 was found defective

Solution:

If the customer complains of this symptom please replace the capacitor with the new value below.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
C609	ELET 470MF/200V	1-104-759-11	ELET 470MF/250V	1-125-600-11

Capacitor location in Power Supply Schematic I-2 Board location D-10