

**TOSHIBA AMERICA CONSUMER PRODUCTS, INC**

**TOSHIBA**

**VCR / CAMERA  
SERVICE BULLETIN  
NO: 60**

**DATE: May/June 1990**

**MODELS: M-120, M-210, M-220,  
M-240, M-440**

**SUBJECT: Clutch Failure**

**SYMPTOM:** No rewind or fast forward. Tape jams in the record or playback mode.

**CORRECTIVE**

**ACTION:** The above symptoms may be due to low take-up torque caused by the clutch cap becoming loose. Perform the reel torque checks as described in section 3 of the Service Data. If the torque values fall below specifications, replace the clutch assembly with a new one.

