

TOSHIBA AMERICA CONSUMER PRODUCTS, INC

TOSHIBA

VCR / CAMERA SERVICE BULLETIN NO: 64

DATE: MAY / JUNE

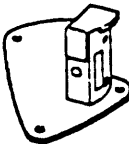
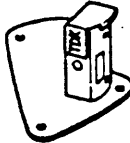


MODELS: M657, M658

SUBJECT: Parts Change

Symptom: FE Head and ACE Head Parts change

Corrective

Action: The FE Head and ACE Head have been changed due to improved reliability.
Replace the FE Head and ACE head with the new parts listed below.

Description	Old [MATSUSHITA]	New [TDK]	Bias current Adjustment
ACE Head Sub Assembly	 Part No. 70183018	 Part No. 70183035	1. Replacing 70183018 with 70183035 = 2.9mVrms 2. Replacing 70183018 with 70183018 = 3.4mVrms 3. Replacing 70183035 with 70183035 = 2.9mVrms
FE Head	 Part No. 70182066	 Part No. 70182084	None