

TOSHIBA AMERICA CONSUMER PRODUCTS, INC.

TOSHIBA

VCR / CAMERA SERVICE BULLETIN NO:71

DATE: NOV 1993

MODELS: M458, M468, M63, M657,
M658, M659, M668,
M758, M759, M769

SUBJECT: Intermittent Audio Recording

Symptom: Intermittent Audio Recording

Corrective

- Action:
1. Change R722 to the new value listed in the table below.
 2. Replace R724 and R725 with a jumper.
 3. Replace Capacitor C722 with the new C-type capacitor listed in the table below.

Location	Original	New	New Part No.
R722	39k Ω 1/8W	18k Ω 1/8W	24871183
R724	6.2 Ω 1/8W	Jumper 0 Ω	N/A
R725	6.2 Ω 1/8W	Jumper 0 Ω	N/A
C722	0.01 μ F/50V, FZ (+30% - 85%)	0.01 μ F/50V, C (+/- 20%)	24285103

UI01 Mecha PC Board

