

TOSHIBA AMERICA CONSUMER PRODUCTS, INC.

TOSHIBA

VCR / CAMERA SERVICE BULLETIN NO:72

DATE: NOV 1993

**MODELS: M228, M249, M448,
M448A, M449, M648, M648A, M649**

SUBJECT: Cassette Loading Malfunction

Symptom: Cassette Loading Malfunction

- 1. Cassette will not load / Cassette loads but is then ejected.**
- 2. Cassette will not eject.**

Corrective

- Action:**
- 1. Replace the right side (R) chassis assembly H540 (Part # 70790037) with the new right side (R) chassis assembly H540 (Part # 70790457). Check the shaft arm assembly H550 (Part # 70790005) and replace if wear is present.**
 - 2. Replace the drive gear assembly B259 (Part # 70790101) with the new type drive gear (Part # 70790393).**

*** Refer to the Service Data for replacement procedures.**

Location	Old Part #	New Part #	Description
H540	70790037	70790457	Chassis Assembly Right (R) Side
H550	70790005	N/A	Shaft Arm Assembly
B259	70790101	70790393	Gear, Eject Drive