

1995**TOSHIBA** Consumer Products

Date: MAR 95

TECHNICAL BULLETIN

No. VCR9502

Product: VCR**Models:** M-650, M650C, M-660, M-660C, M-750, M-750C, M-750J**Subject:** Color shading in picture.**Ref. #:** 11A-9405**Symptom:** Color shading (purity error) due to tape vibration jitter (impact jitter).**Required part(s):**

Location	Part No.	Description
N/A	70364004	Shaft (impedence roller)
N/A	70346452	Impedence Roller Assembly

Corrective Action: 1) Place Shaft A into the main base hole until it stops.

2) Mount the Impedence Roller assembly onto Shaft A.

3) Perform the Linearity Adjustment within the Tape Transport Adjustment section of the service manual.

Note: The top cover will hold the impedance roller in place. Therefore, no stopper bracket is necessary.