

1996

TOSHIBA AMERICA CONSUMER PRODUCTS, INC.

Date: MAR 96

# TECHNICAL BULLETIN

No.VCR9604

Product: VCR

Countries affected: USA, CANADA

MODELS	VCR					TV/VCR
USA	M-650	M-660	M-750	M-751	M-760	CV27D48
CANADA	M-650C	M-660C	M750C		M-760C	

**NOTE:** The information provided below should only be used if you encounter the symptom(s) listed.

**Subject:** Part enhancement.

**Ref.#** 11A-9507

**Symptom:** No picture due to possible wear on FPC wire etching.

**Required part(s):** None

**Corrective Action:** Place cotton, vinyl, or acetate tape on the FPC (Flexible Printed Circuit) wire of the rotary transformer, as shown in fig. 1, to prevent shorting between the FPC and cylinder holding plate.

**Note:** This countermeasure should only be used if you encounter the above mentioned symptom and is applicable to the following lot numbers only: 941209 - 950113. The lot number is marked on the top of the cylinder head. (see fig. 2)

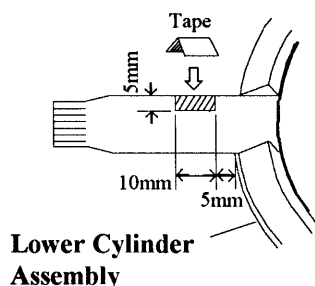


FIG. 1

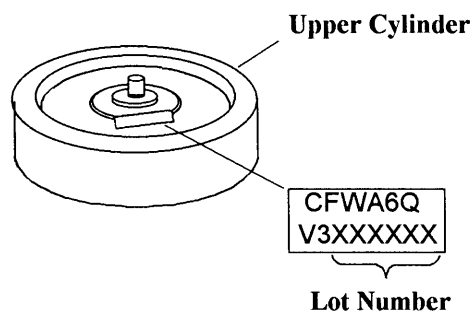


FIG. 2