

1995

**TOSHIBA CONSUMER PRODUCTS, INC.**

Date: MAR 95

**TECHNICAL BULLETIN**

No. VCR9501A

**Product:** VCR**Countries affected:** USA, CANADA, JAPAN

MODEL	VCR				
USA	M-650	M-660	M-750	M-760	M-770
CANADA	M-650C	M-660C	M-750C	M-760C	
JAPAN			M-750J	M-760J	

**Subject:** Power supply switching interference.**Ref. #:** 10A-9402**Symptom:** TV picks up power supply switching interference from VCR.**Required part(s):**

Location	Part No.	Description
N/A	70903925	Capacitor Kit


**PARTS KIT 70903925 CONTAINS:**

Location	Part No.	Description	Q'ty
C817	24212102	Capacitor, CD 1000pF 50v K	1
C819	24215101	Capacitor, CD 100pF 1kV	1
C833,834	24094820	Capacitor, CD 2200pF 125V M	2

**Corrective Action:** 1) Remove capacitor C802.

2) Add 4 Capacitors, from 70903925 capacitor kit above, to the foil side of Main PC board, as shown in the illustrations on the attached sheet or these the following verbal instructions: Add C817 across D822, add C819 across pins 3 and 4 of IC803, add C833 from + AC side of D803 to the -DC side of D803 and add C833 from the -DC side of D803 to the -AC side of D803.

# POWER SUPPLY CIRCUIT DIAGRAM

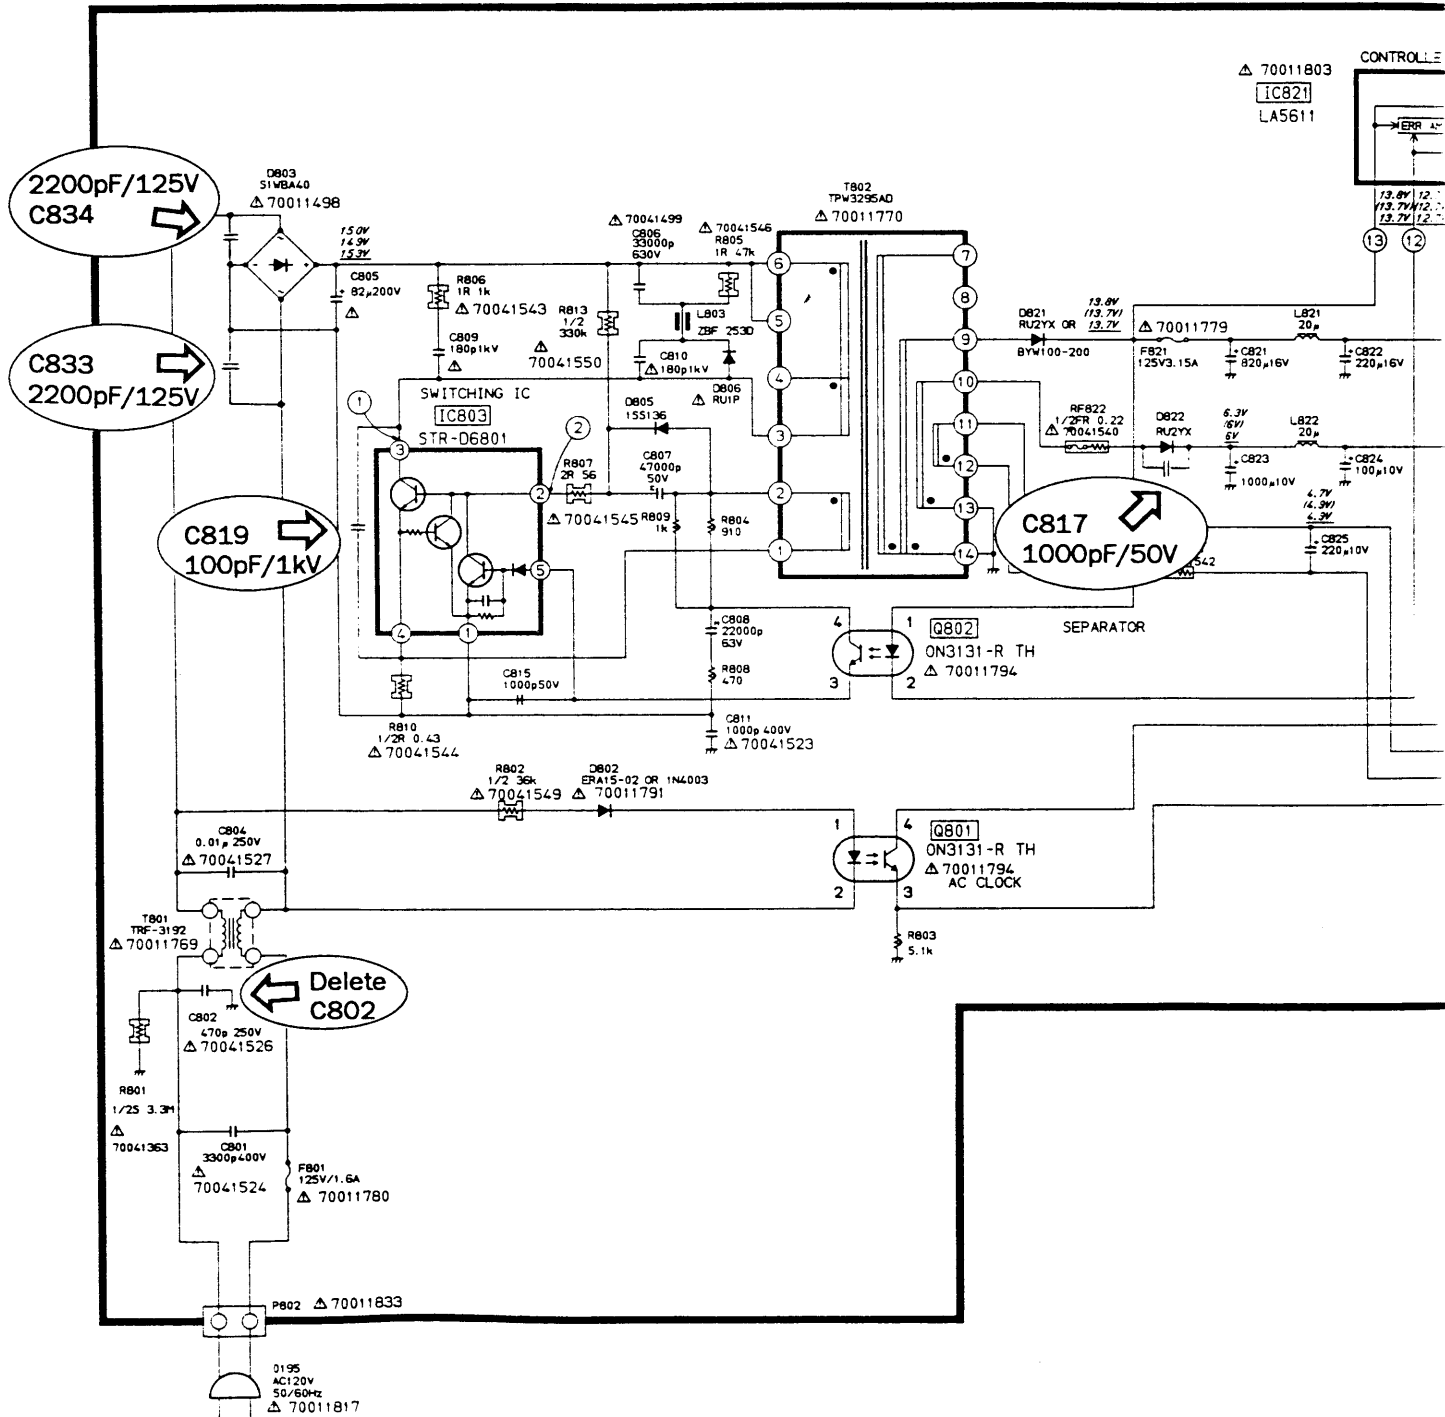

# PARTS LOCATION DIAGRAM

