

1995**TOSHIBA** Consumer Products

Date: MAR 95

TECHNICAL BULLETIN

No. VCR9505

Product: VCR

Models: M-760, M-760C

Subject: Correction notice of service manual. New part.

Ref.# 11B-9403

Symptom: N/A

Required part(s):

Location	Part No.	Description
G610	from 70031546	Roller, Impedance
-	to 70903953	Roller Kit, Impedance

PARTS KIT 70903953 CONTAINS:

Location	Part No.	Description	Q'ty
G610	70346455	Roller, Impedance	1
-	70975082	Instructions	1

Corrective Action: Please update your service manual according to the above information.**Note:**

- 1) Remove the stopper bracket, G618 (see fig. below), when replacing the old impedance roller with the new type.
- 2) The new impedance roller has a longer shaft. The top of the new impedance roller shaft will touch the top cover. Therefore, the shaft will not come off during transportation.
- 3) The new type impedance roller has been applied into production since the end of October, 1994.
- 4) Temporarily remove the new type impedance roller when servicing.

