

1996**TOSHIBA AMERICA CONSUMER PRODUCTS, INC.***Date: MAR 96***TECHNICAL BULLETIN****No. VCR9606****Product: VCR****Countries affected: USA, CANADA**

MODEL	VCR		
USA	M-659	M-759	M-769
CANADA	M-659C	M-759C	M-769C

NOTE: The information below should only be used if you encounter the symptom(s) listed:**Subject:** VCR Plus code fails.**Ref.#** 11A-9509

Symptom: In some very rare instances, when the VCR Plus program is set from 12:00pm to 12:59pm the start time may change from pm to am.

Part(s) required:

Location	Part No.	Description
ICX01	From 70011555	IC, UPD78044GF-035
	To 70200050	IC, UPD78044GF-131-3B9

Corrective Action: If the above symptom occurs replace ICX01 with the new type above.