

1996

TOSHIBA AMERICA CONSUMER PRODUCTS, INC.

Date: May 96

## TECHNICAL BULLETIN

No. VCR9607

Product: VCR

Countries affected: USA, CANADA

	VCR MODEL					
USA	M261	M456	M461	M471	M656	M661
CANADA	M261C		M461C	M471C	M656C	M661C

**NOTE:** The information in this bulletin should only be used if you encounter the symptom(s) listed.


**Subject:** Cold solder joint on Start Sensor, S601.

**Ref.#** VC9601

**Symptom:** The VCR turns off a few seconds after it is turned on. In some cases, the cassette holder assembly tries to load without a tape.

**Part(s) required:** None

**Corrective Action:** Resolder the cold joint on the Start Sensor, S601, on the main PC board. Also check the solder joints on the End Sensor, S602. Thoroughly check the operation of the unit before it is returned.

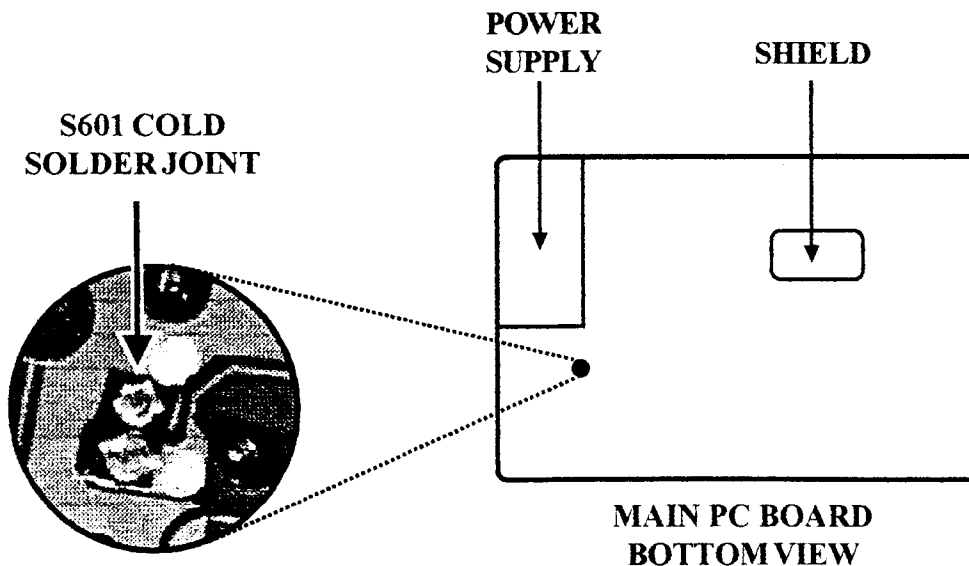

### PRODUCT SAFETY PRECAUTIONS

Product safety precautions are covered in the Toshiba service manual(s) pertaining to the model(s) covered in this bulletin. All safety precautions and checks shall be complied with before returning the equipment to the customer. Servicers who defeat safety features or fail to perform safety checks may be liable for any resulting damages and may expose themselves and others to possible injury.