

1996

TOSHIBA AMERICA CONSUMER PRODUCTS, INC.

Date: June 96

TECHNICAL BULLETIN

No. VCR9609

Product: VCR

MODEL

M761

M761C

NOTE: The information in this bulletin should only be used if you encounter the symptom(s) listed.


Subject: The trace carrying the 3.58MHz reference signal to the Color Signal Enhancement (CSE) board may be broken at pin 13 of PU01.

Ref.# VC9603

Symptom: There may be no color in playback of a known good tape. Tapes recorded on the VCR in question have color when played on a known good machine. This problem may be intermittent.

Part(s) required: None

Corrective Action: Solder a jumper between pin 13 of PU01 and the solder pad approximately one quarter of an inch out on the trace. This solder pad is where the trace turns at a 45 degree angle.

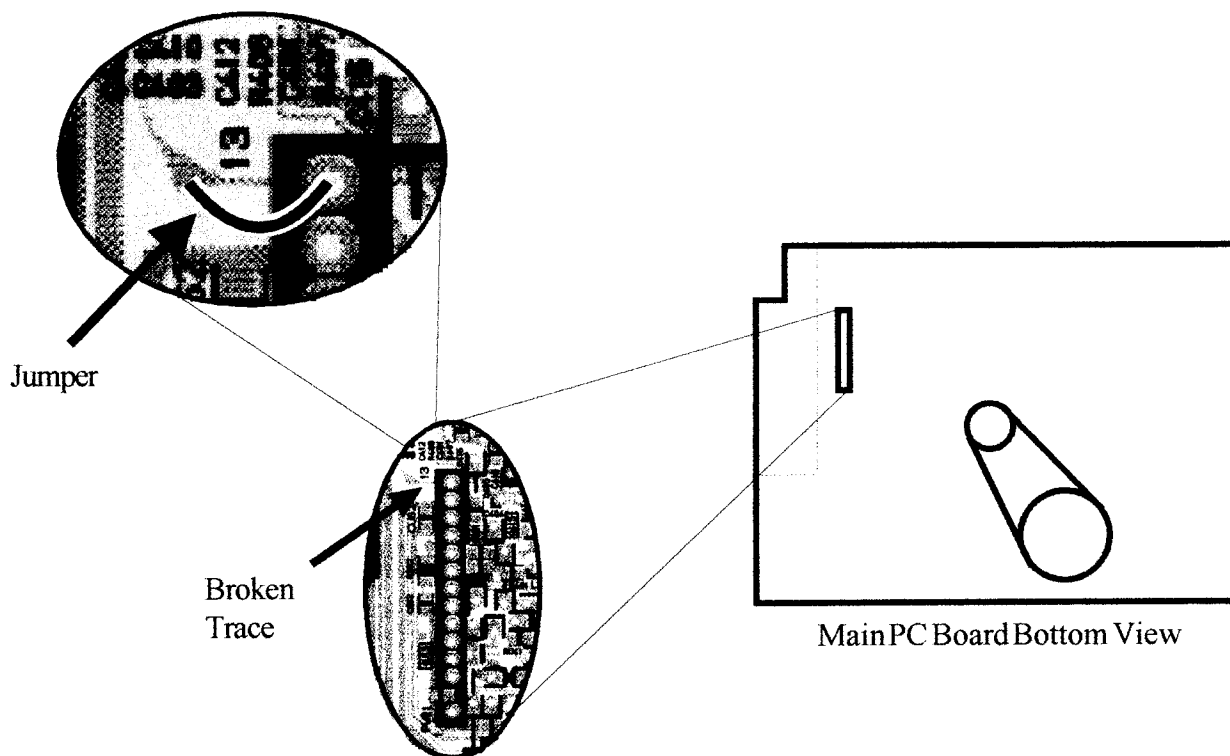

PRODUCT SAFETY PRECAUTIONS

Product safety precautions are covered in the Toshiba service manual(s) pertaining to the model(s) covered in this bulletin. All safety precautions and checks shall be complied with before returning the equipment to the customer. Servicers who defeat safety features or fail to perform safety checks may be liable for any resulting damages and may expose themselves and others to possible injury.