

# Dictation Products Service Bulletin

CSA-15

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** BI-85, BM-77, BM-88

**No.** 27

**Subject:** Original FWD Motor No Longer Available

**Date:** June 15, 1995

**Symptom:**

(\*\*)

The original FWD Motor is no longer available.


**Solution:**

Please use the new FWD Motor ASSY listed below for replacement. This new motor is used for BM-89.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
M901	MOTOR (FWD)	1-541-748-11	MOTOR (FWD) ASSY	X-3369-458-1

**Motor Assembly Installation**

- Remove the original wiring from the original motor. Remove the original motor from the mechanical chassis.
- Remove the motor cushion No. 137.
- Install the cushion No. 137 on new motor and reverse the procedure.

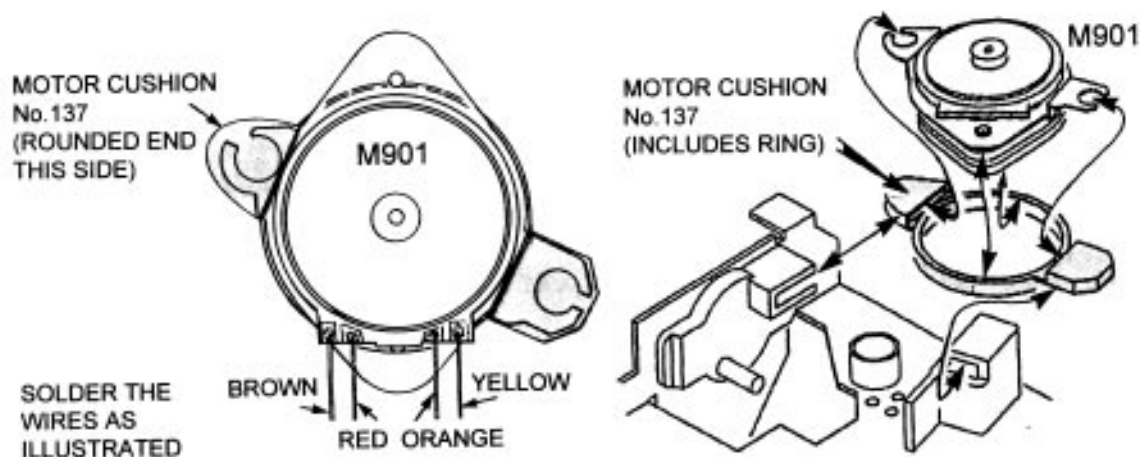

Filename: DIC0027.SB  
Directory: J:\SBDOC\JUN95  
Template: C:\WINWORD\TEMPLATE\S\_BULL.DOT  
Title:  
Subject:  
Author: Hoyt Wing Lee  
Keywords:  
Comments:  
Creation Date: 06/15/95 9:39 AM  
Revision Number: 2  
Last Saved On: 06/15/95 9:39 AM  
Last Saved By: Hoyt Wing Lee  
Total Editing Time: 0 Minutes  
Last Printed On: 04/01/96 9:03 AM  
As of Last Complete Printing  
Number of Pages: 1  
Number of Words: 154 (approx.)  
Number of Characters: 881 (approx.)