

SONY

TV Products Service Bulletin

Sony Service Company · Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: KPR-46CX25/46EX25/53EX20

No. 71


Subject: R-697 Omitted From Service Manual **Date:** February 8, 1991

Symptom:
(**)

Resistor R-697 was omitted from the schematic.

Solution: Please add Resistor R-697 between pin 6 of T-605 and pin 2 of T-607 on the "G" Board to your service manual schematic.

Ref. No.	Description	Part Number
R-697	1.2 Ohm 1/6 Watt Carbon Resistor	1-249-382-11

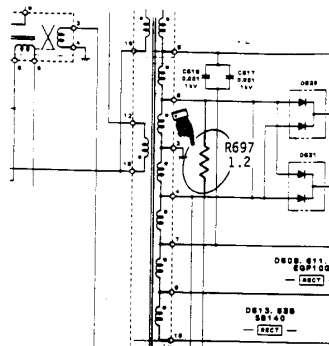

CSV-1 Projection TV

Reference: Fax T-487

PRINTED IN U.S.A.
CSV-1191-10