


Model: KV-20M42, KV-20S90**No.** 535**Subject:** Potential 30MHz Interference**Date:** May 17, 2001**Symptom:**
(1341)

When the TV is on; other devices may pick up interference from the TV.

Solution:

In order to improve the slight possibility of interference at 30MHz a Ferrite Core has to be added to the AC cord at the end closest to the rear cabinet. See fig 1

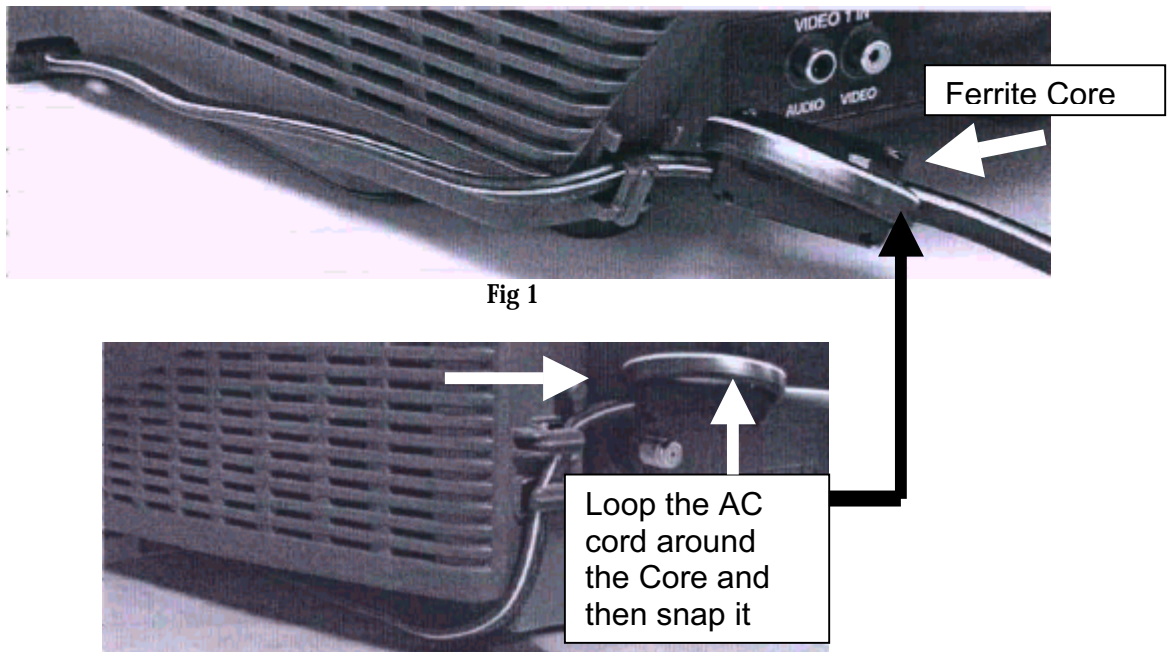

Model	Description	Part Number	Serial Number range that need this Ferrite Core
KV-20M42	Ferrite Core	1-500-386-11	4170001-4175650
KV-20S90	Ferrite Core	1-500-386-11	4000001-4000150