

Fig. 2-5 TR12 Base



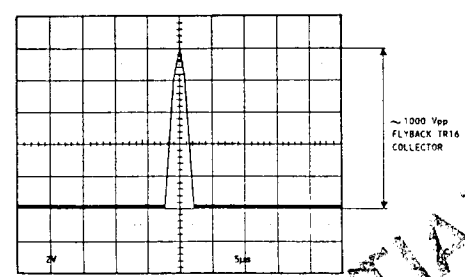


Fig. 2-7 TR16 Collector

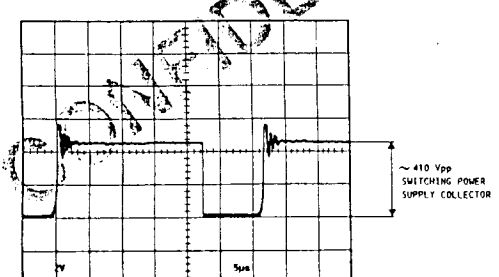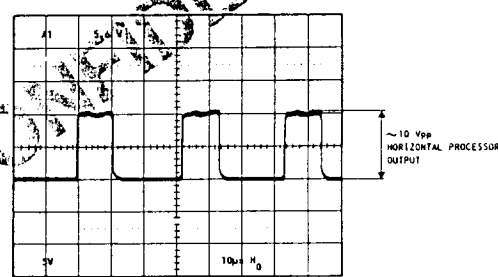



For Service Mar
contact
MAURITRON SEF
8 Cherry Tree Road,
Oxfordshire, OX5
Tel (01844) 351
Fax (01844) 352

olivetti


HANTAREX

East-West Correction

Characters and Picture Missing

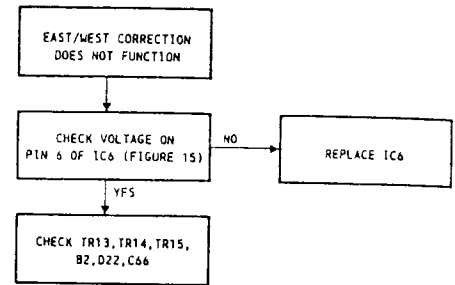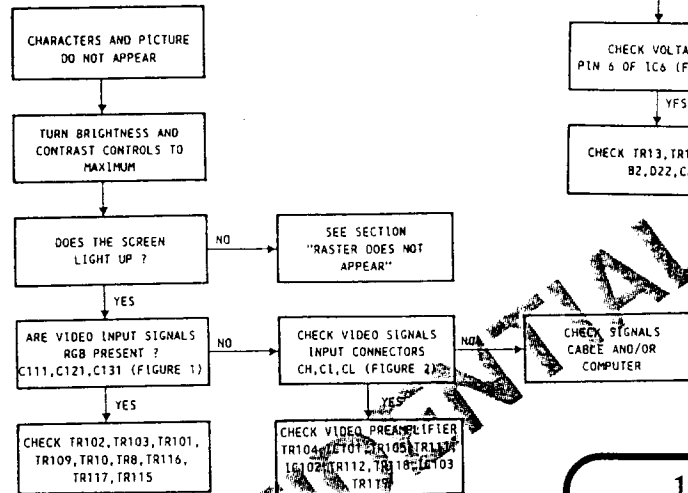

Raster Missing

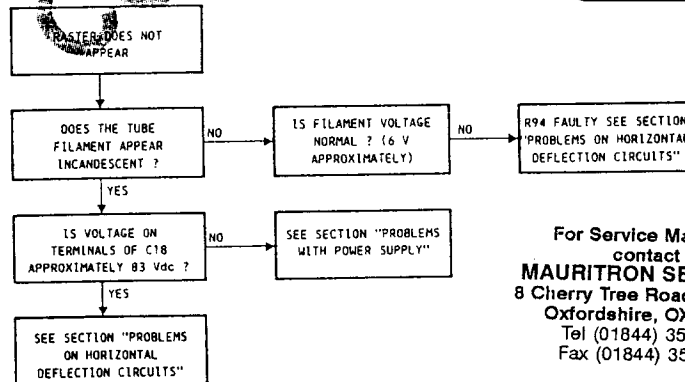

1431.
1431/HA01.
CDU-1431.
CDU-1431/HA01.

For Service Manuals
contact
MAURITRON SERVICES
8 Cherry Tree Road, Chinnor
Oxfordshire, OX9 4QY.
Tel (01844) 351694
Fax (01844) 352554

I.B.: LA SCRITTA "OLIVETTI" CHE SI TROVA
SUL CORRISPONDENTE DEVE
CORRISPONDERE ALLA PARTE PIU STRETTA
DEL CONNETTORE A VASCETTA.

del cavo
1 Colore: (G-I-N-E-G-I-A-E-H-A)
2 Colore: (G-I-N-E-G-I-A-E-H-A)
3 Colore: (G-I-N-E-G-I-A-E-H-A)

Colore Inter Dark BYR 5,75/05
Colore di tipo "TRANSFUSIONE 99HIF" Display
PER SUO PANNELLO A VASCETTA 250 LCM. Display
Uscita PVC a 105°C 03 di L. 120mm. Display
TO Display
NRE PAR. NUMERO
Firma

| | | |
|----------------------|---------|----------|
| Denominazione | Data | Codice |
| INGRESSO SEGNALI PER | 25-4-88 | 61006240 |
| 1431 (VGA COLORE) | UTC 650 | Firma |

For Service Manuals
contact
MAURITRON SERVICES
8 Cherry Tree Road, Chinnor
Oxfordshire, OX9 4QY.
Tel (01844) 351694
Fax (01844) 352554

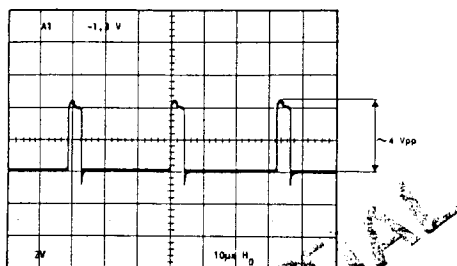


Fig. 2-9 Pin 9 of TDA2593



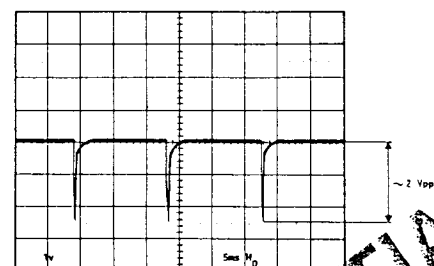



Fig. 2-11 Pin 4 of TDA1678A

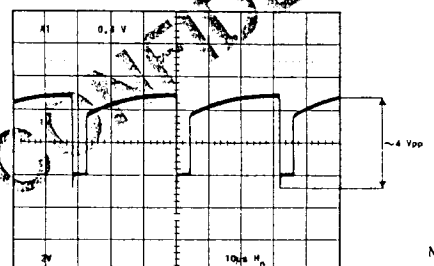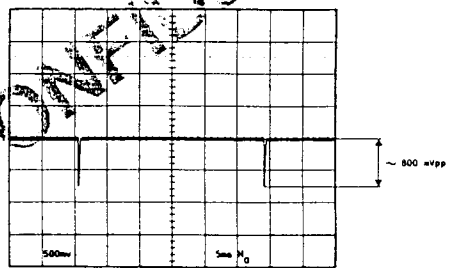

MAURITRON

106


**For Service Manuals
contact
MAURITRON SERVICES**
8 Cherry Tree Road, Chinnor
Oxfordshire, OX9 4QY.
Tel (01844) 351694
Fax (01844) 352554

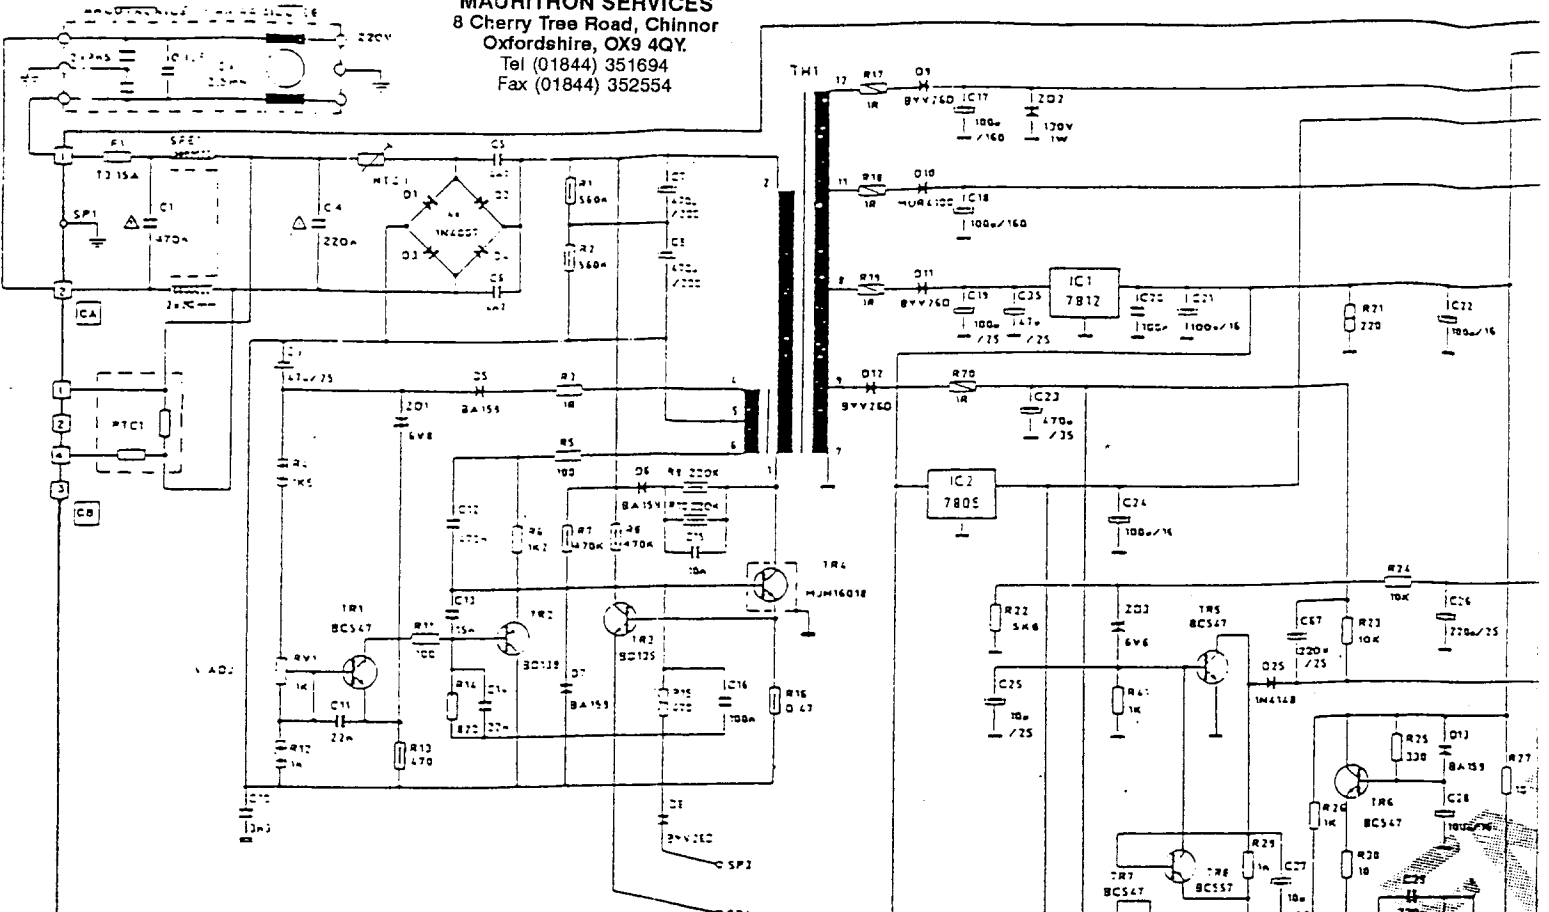


SCHEMATIC NOTES

UNLESS OTHERWISE SPECIFIED

RESISTANCE




CAPACITANCE





SECRET






CONNECTOR FILTER

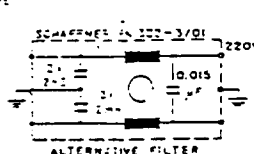

ALTERNATIVE FILTER

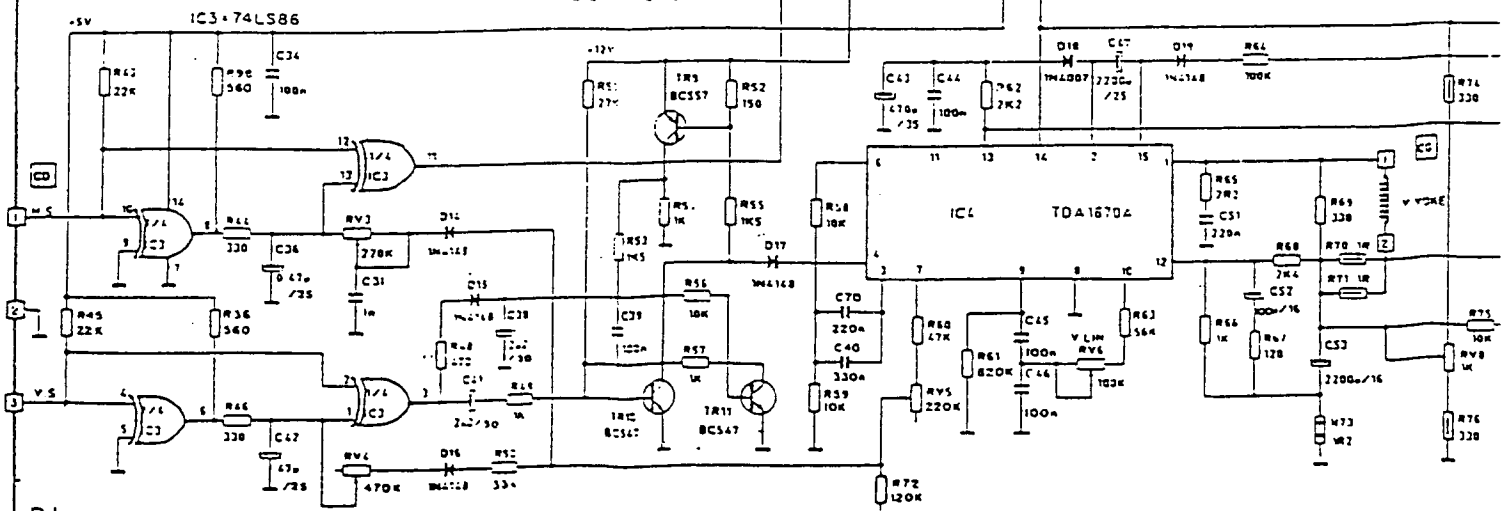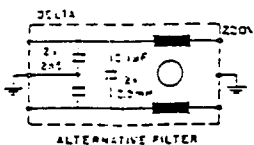


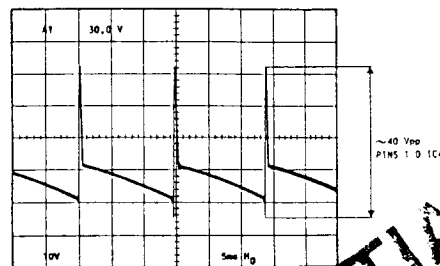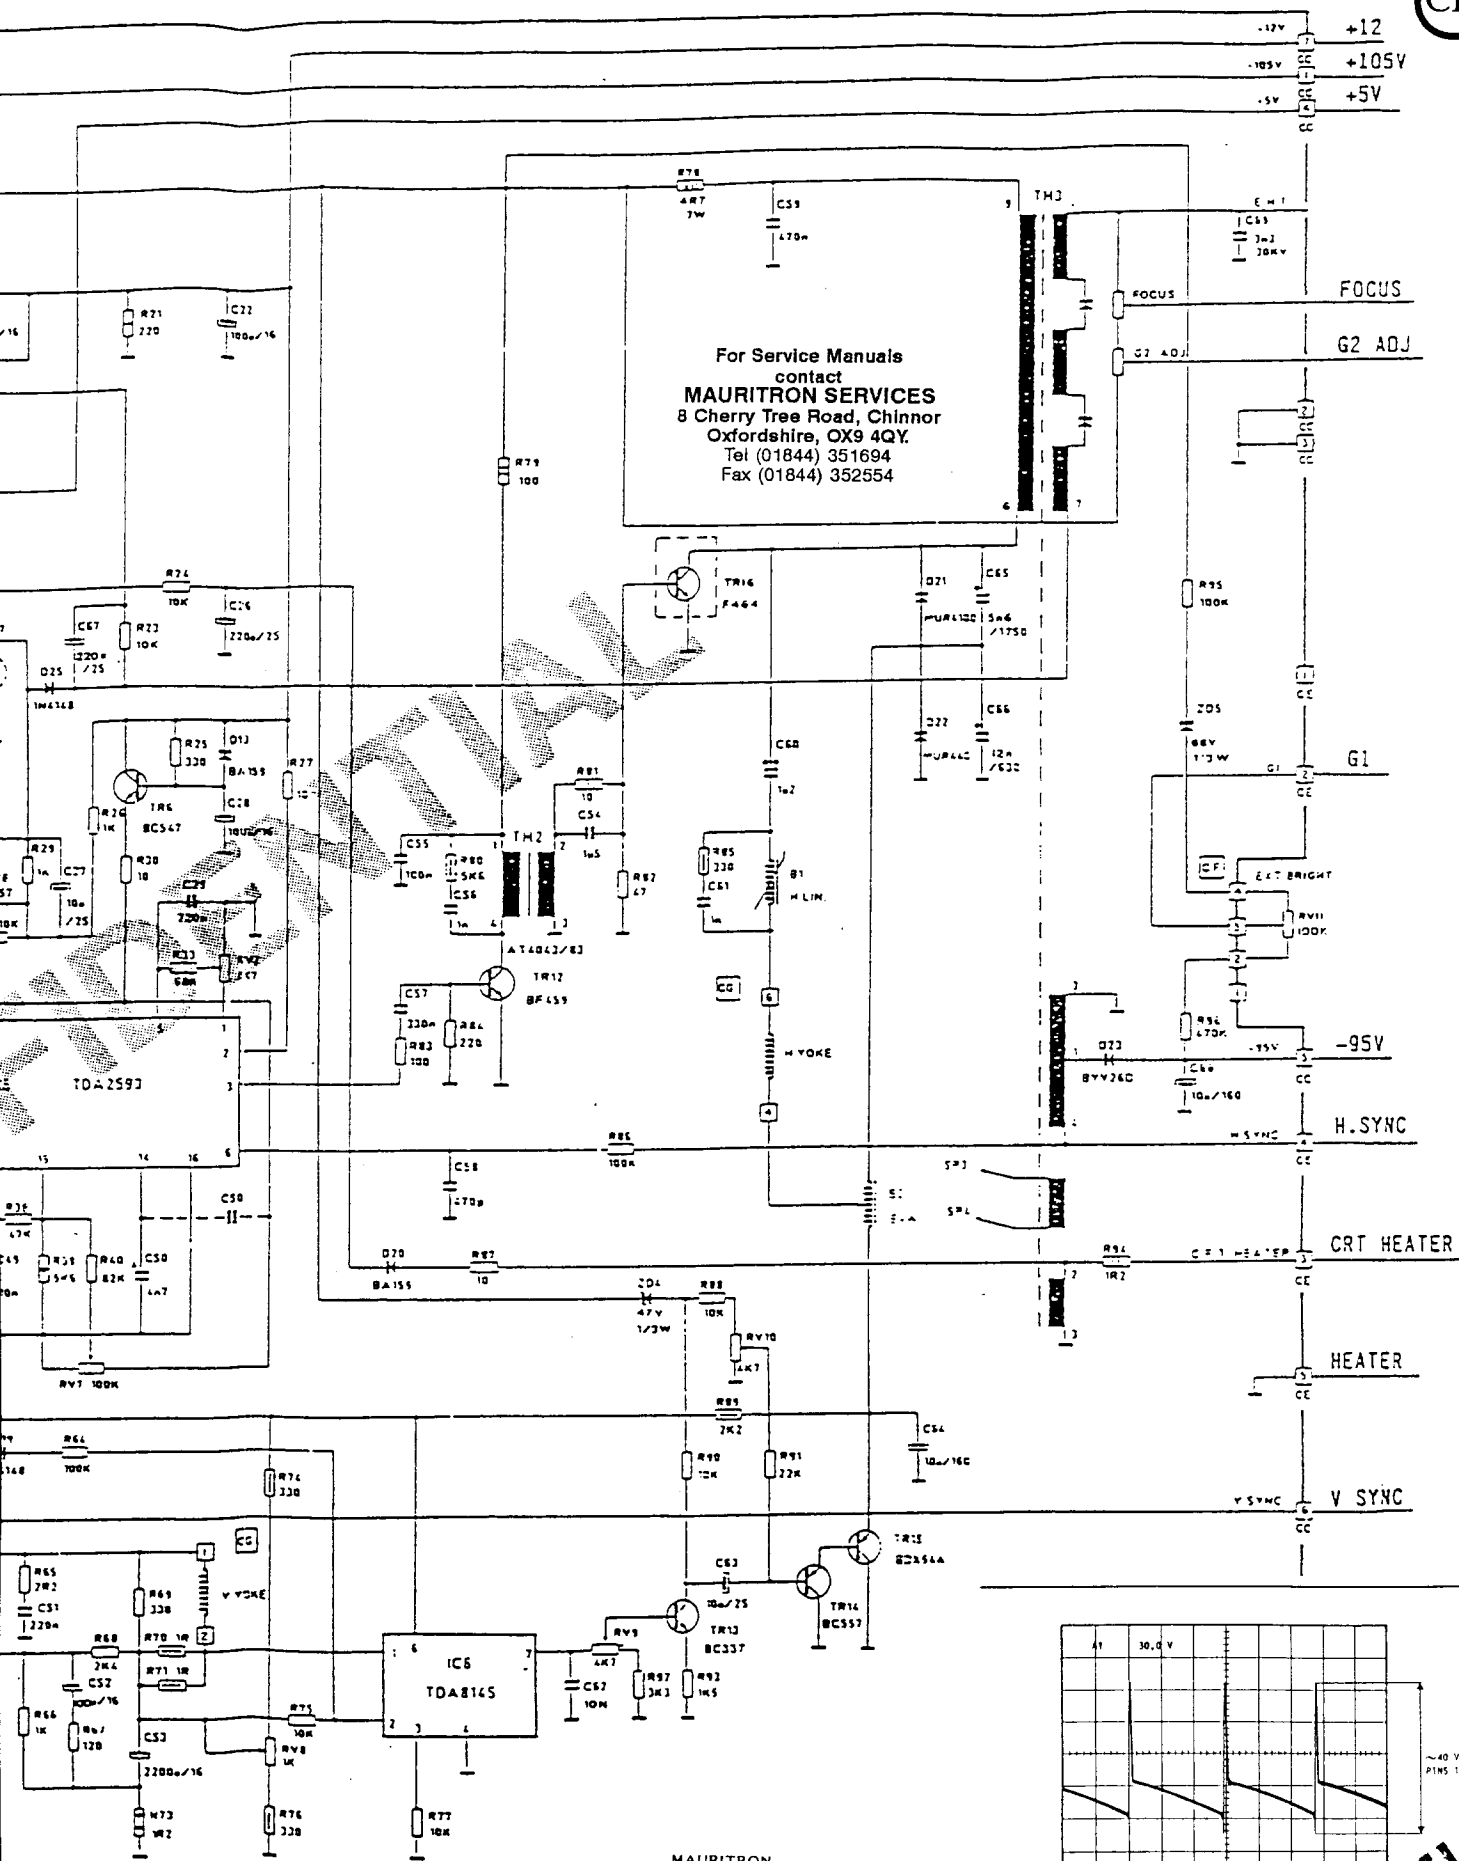

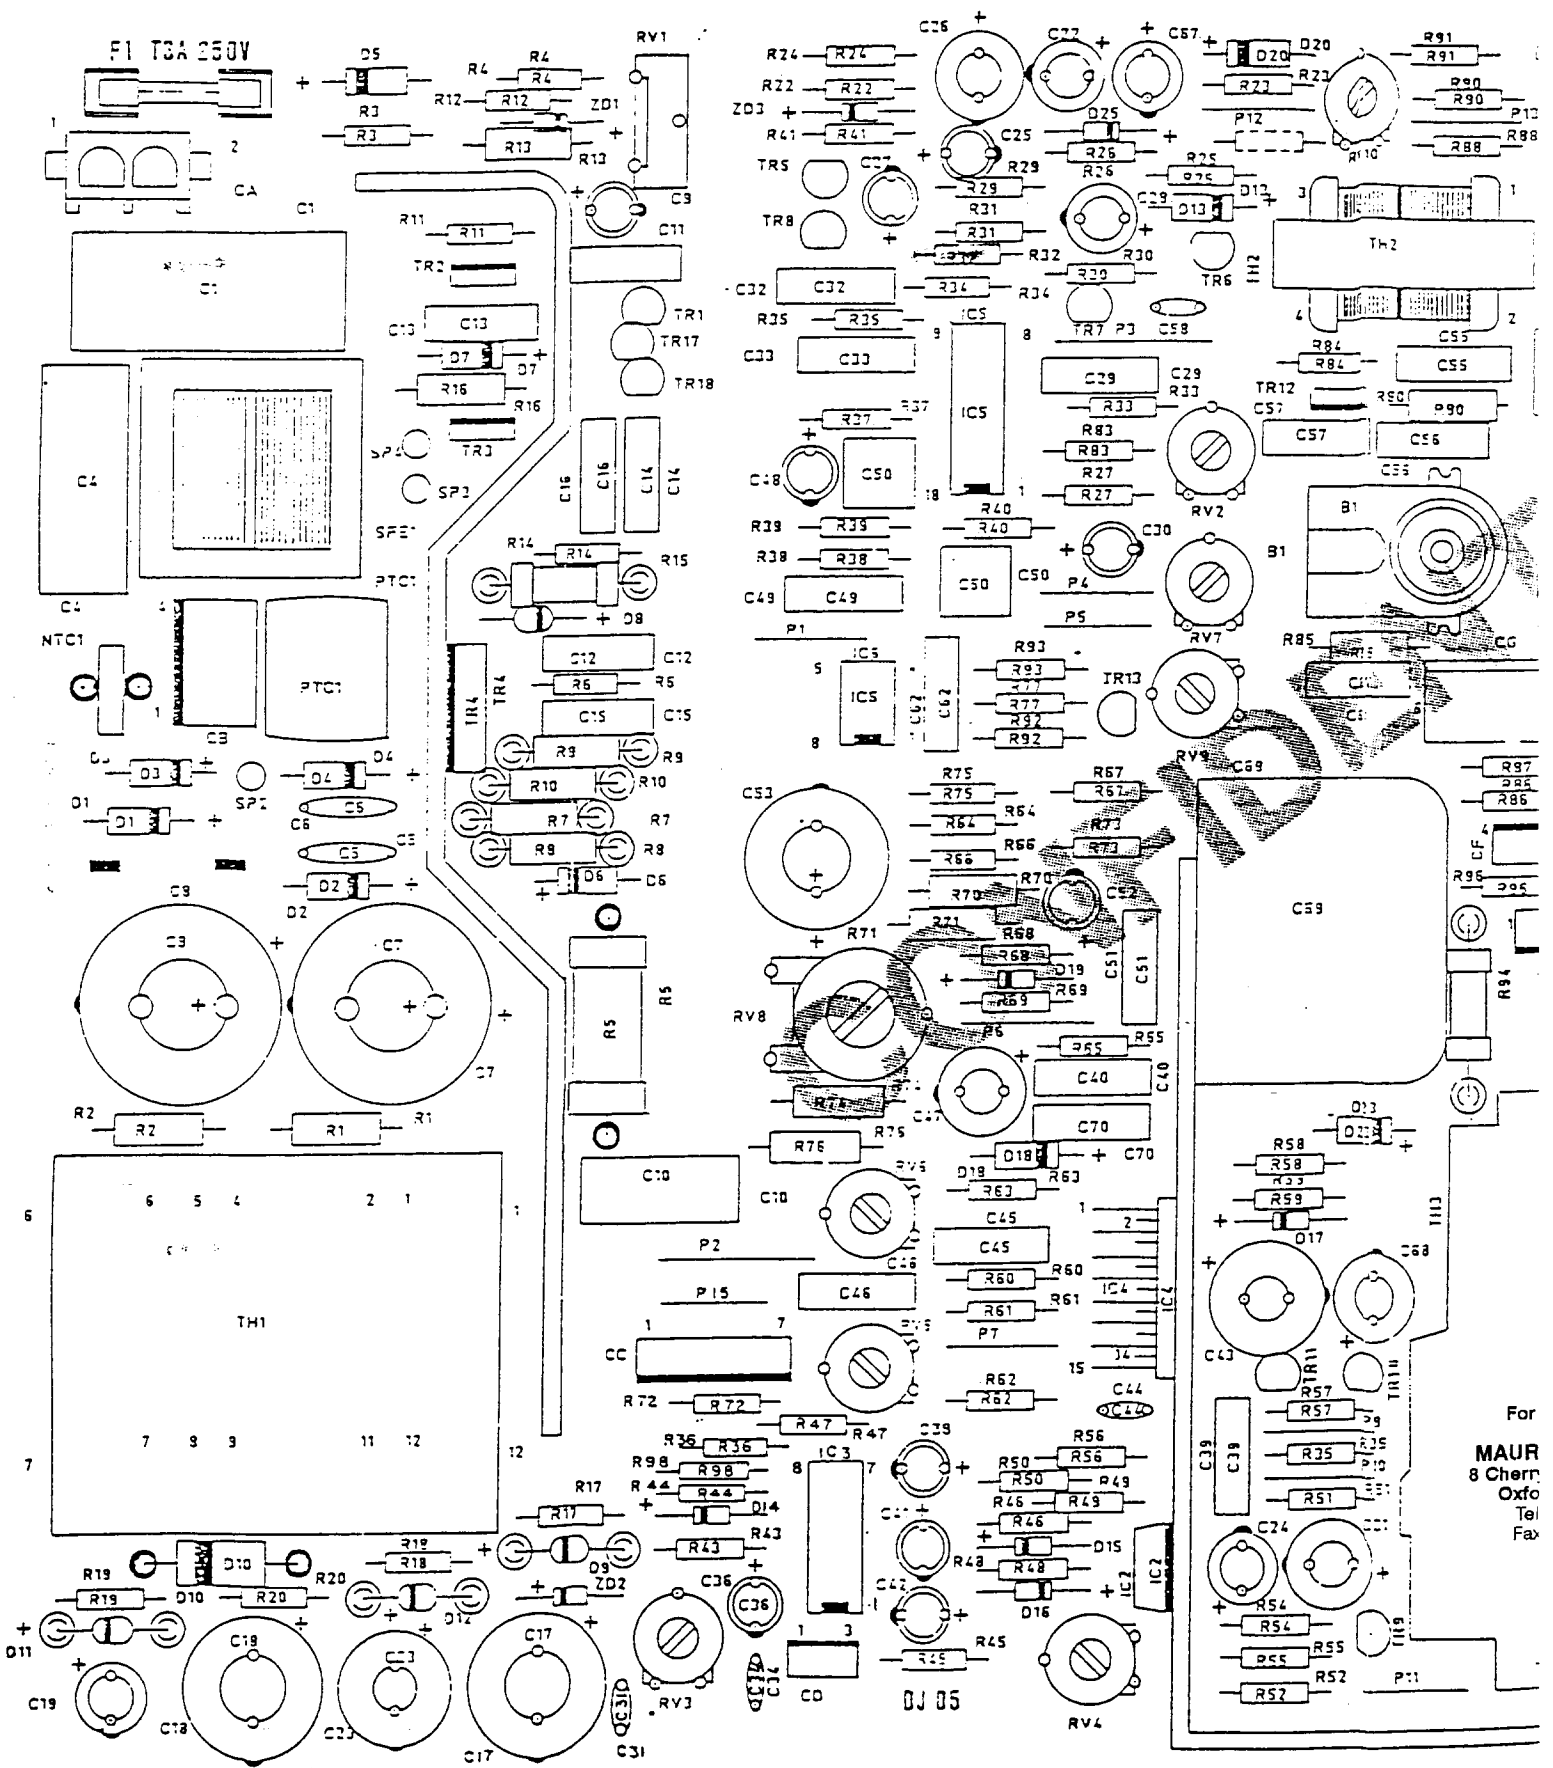


For
MAUR
8 Chem.
Oxfo
Tel
Fax

Vertical Deflection not Working

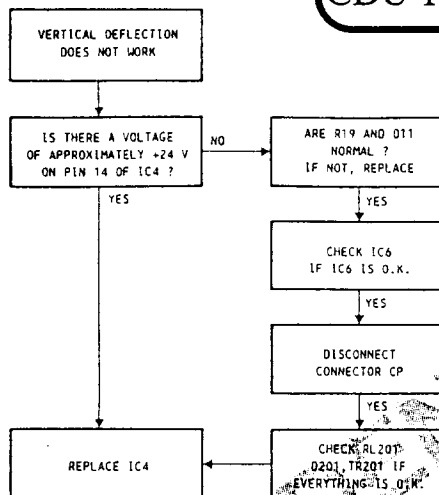

Power Supply Problems

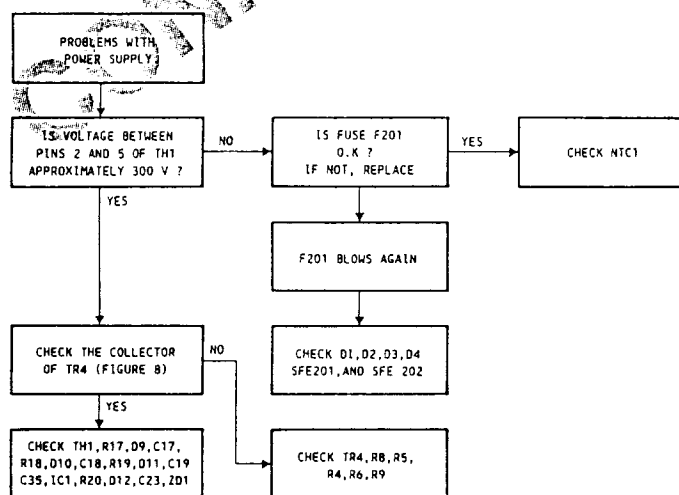

For Service Manuals
contact
MAURITRON SERVICES
8 Cherry Tree Road, Chinnor
Oxfordshire, OX9 4QY.
Tel (01844) 351694
Fax (01844) 352554

For Service Manuals
contact
MAURITRON SERVICES
8 Cherry Tree Road, Chinnor
Oxfordshire, OX9 4QY.
Tel (01844) 351694
Fax (01844) 352554


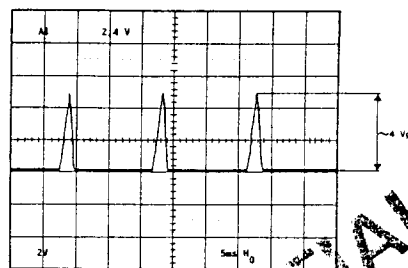


Fig. 2-13 Pin 4 of IC3

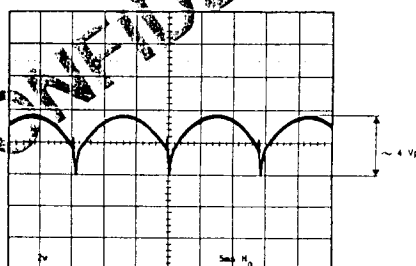

1431.
1431/HA01.
CDU-1431.
CDU-1431/HA01.


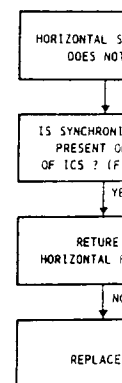


Fig. 2-1 Pin

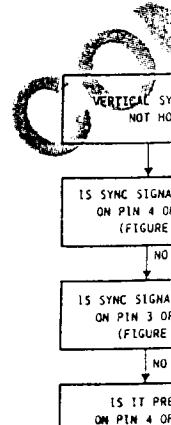


Fig. 2-2 Contd

Horizontal Sync



Vertical Sync Po



TIMING DIAGRAMS

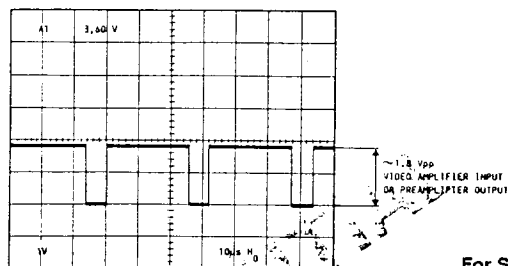


Fig. 2-1 Pin 5 of CA3046

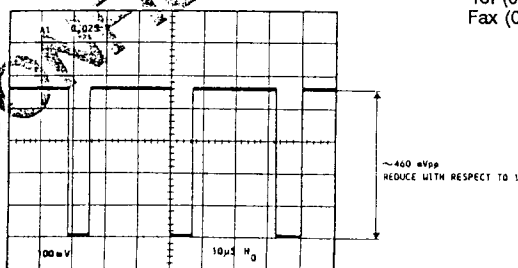


Fig. 2-2 Connectors CH, CI, CL

For Service Manuals
contact
MAURITRON SERVICES
8 Cherry Tree Road, Chinnor
Oxfordshire, OX9 4QY.
Tel (01844) 351694
Fax (01844) 352554

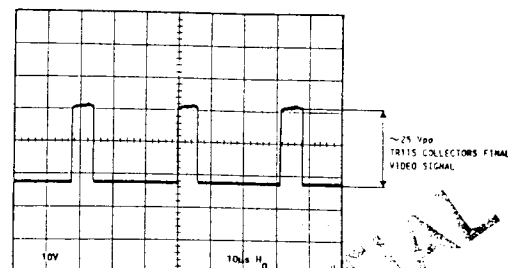


Fig. 2-3 TR115 Collector


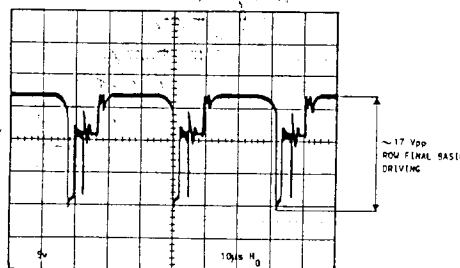


Fig. 2-4 TR16 Base


Horizontal Sync Problems

For Service Manuals
contact
MAURITRON SERVICES
8 Cherry Tree Road, Chinnor
Oxfordshire, OX9 4QY.
Tel (01844) 351694
Fax (01844) 352554

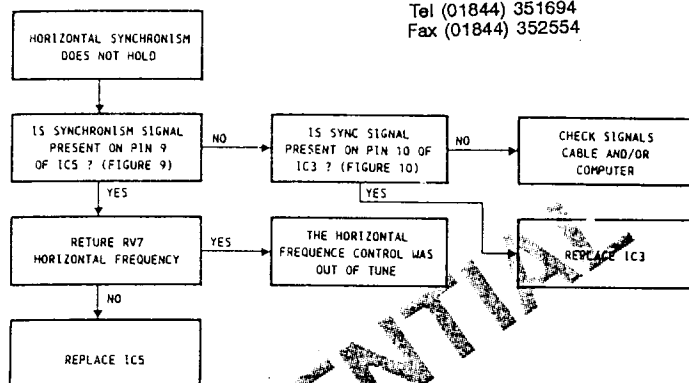

Vertical Sync Problems

For Service Manuals
contact
MAURITRON SERVICES
8 Cherry Tree Road, Chinnor
Oxfordshire, OX9 4QY.
Tel (01844) 351694
Fax (01844) 352554

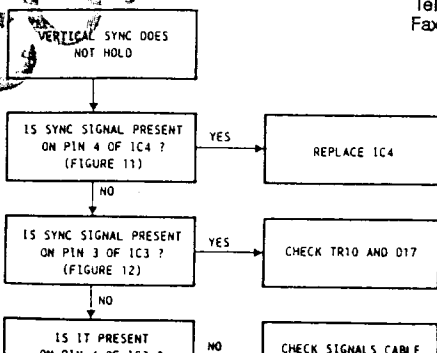

Horizontal Deflection Circuit Problems

