

SONY

Video Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: SLV-353UC/555UC/757UC

No. 98

Subject: Emergency Shut-Off During
Playback/Review Mode

Date: November 24, 1989


Symptom:
(12)

The unit goes into emergency shut-off during the Playback/Review Mode and does not accept any function key commands.

Solution: Replace PH001 and PH002 on the "MD-22" Board and add two diodes to the foil side of the circuit as shown in the following diagram.

Parts List:

Ref. No.	Description	Part Number
PH001	IC PS6002	8-759-144-33
PH002		
---	Diode RD-6.2ESB2	8-719-109-93

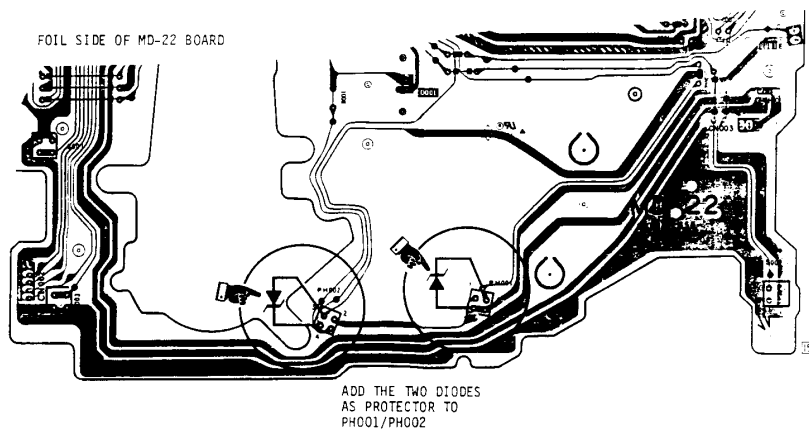

(Continued)

Reference: HV-895010

PRINTED IN U.S.A.
CSV-21189-1

VHS
CSV2

CIRCUIT DIAGRAM

