

SONY

Video Products  
Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

Model: SLV-353UC/555UC/757UC

No. 131

Subject: Unit Shuts Down (Photo Sensor Kit) Date: September 28, 1990

Symptom:  
(22)


Unit shuts off during PB, REV, FF, or REW.

Solution: A Photo Sensor Kit should be installed whenever any of the above symptoms occur.

Description	Part Number
Photo Sensor Kit	Kit A-6759-480-A

Kit Parts:

Qty	Description
1	SC Ground Leaf Spring
2	RD 6.2-ESB2 Diodes
2	Photo Sensors - PS6002
2	1000pF Ceramic Capacitors

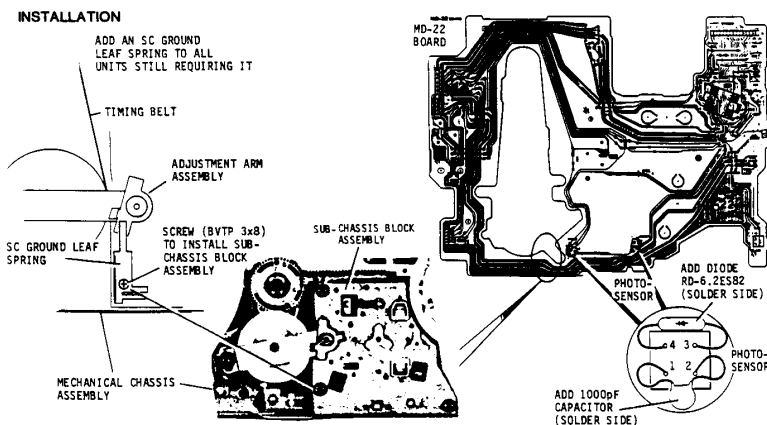

Reference: HV-895010  
Autoflagging: (YES)

PRINTED IN U.S.A.  
CSV-2990-2

CSV-2 VHS