

TOSHIBA AMERICA CONSUMER PRODUCTS, INC

TOSHIBA	VCR / CAMERA SERVICE BULLETIN NO: 68
DATE: November / December 1992	MODELS: M-458, M-468, M-657, M-658, M-668, M-758
SUBJECT: S-Soft Brake Lever	


Symptom: Will not play due to loading malfunction.

Corrective Action: Replace the soft brake lever K128 with the new black colored one.


Required Part:

Location	Part No.	Vendor	Description
K128	70366026	J	Lever, S-Soft Brake

70366026

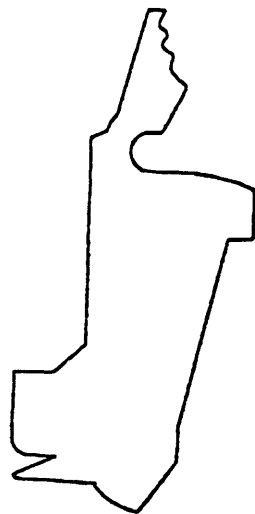

**White
(Previous)**

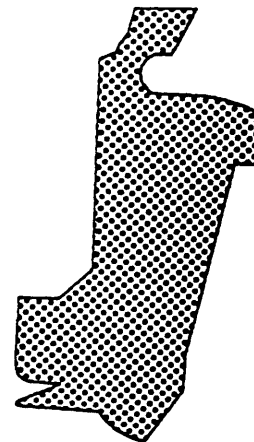

**Black
(Current)**