





SCHEMATIC DIAGRAM


StudioWorks77i

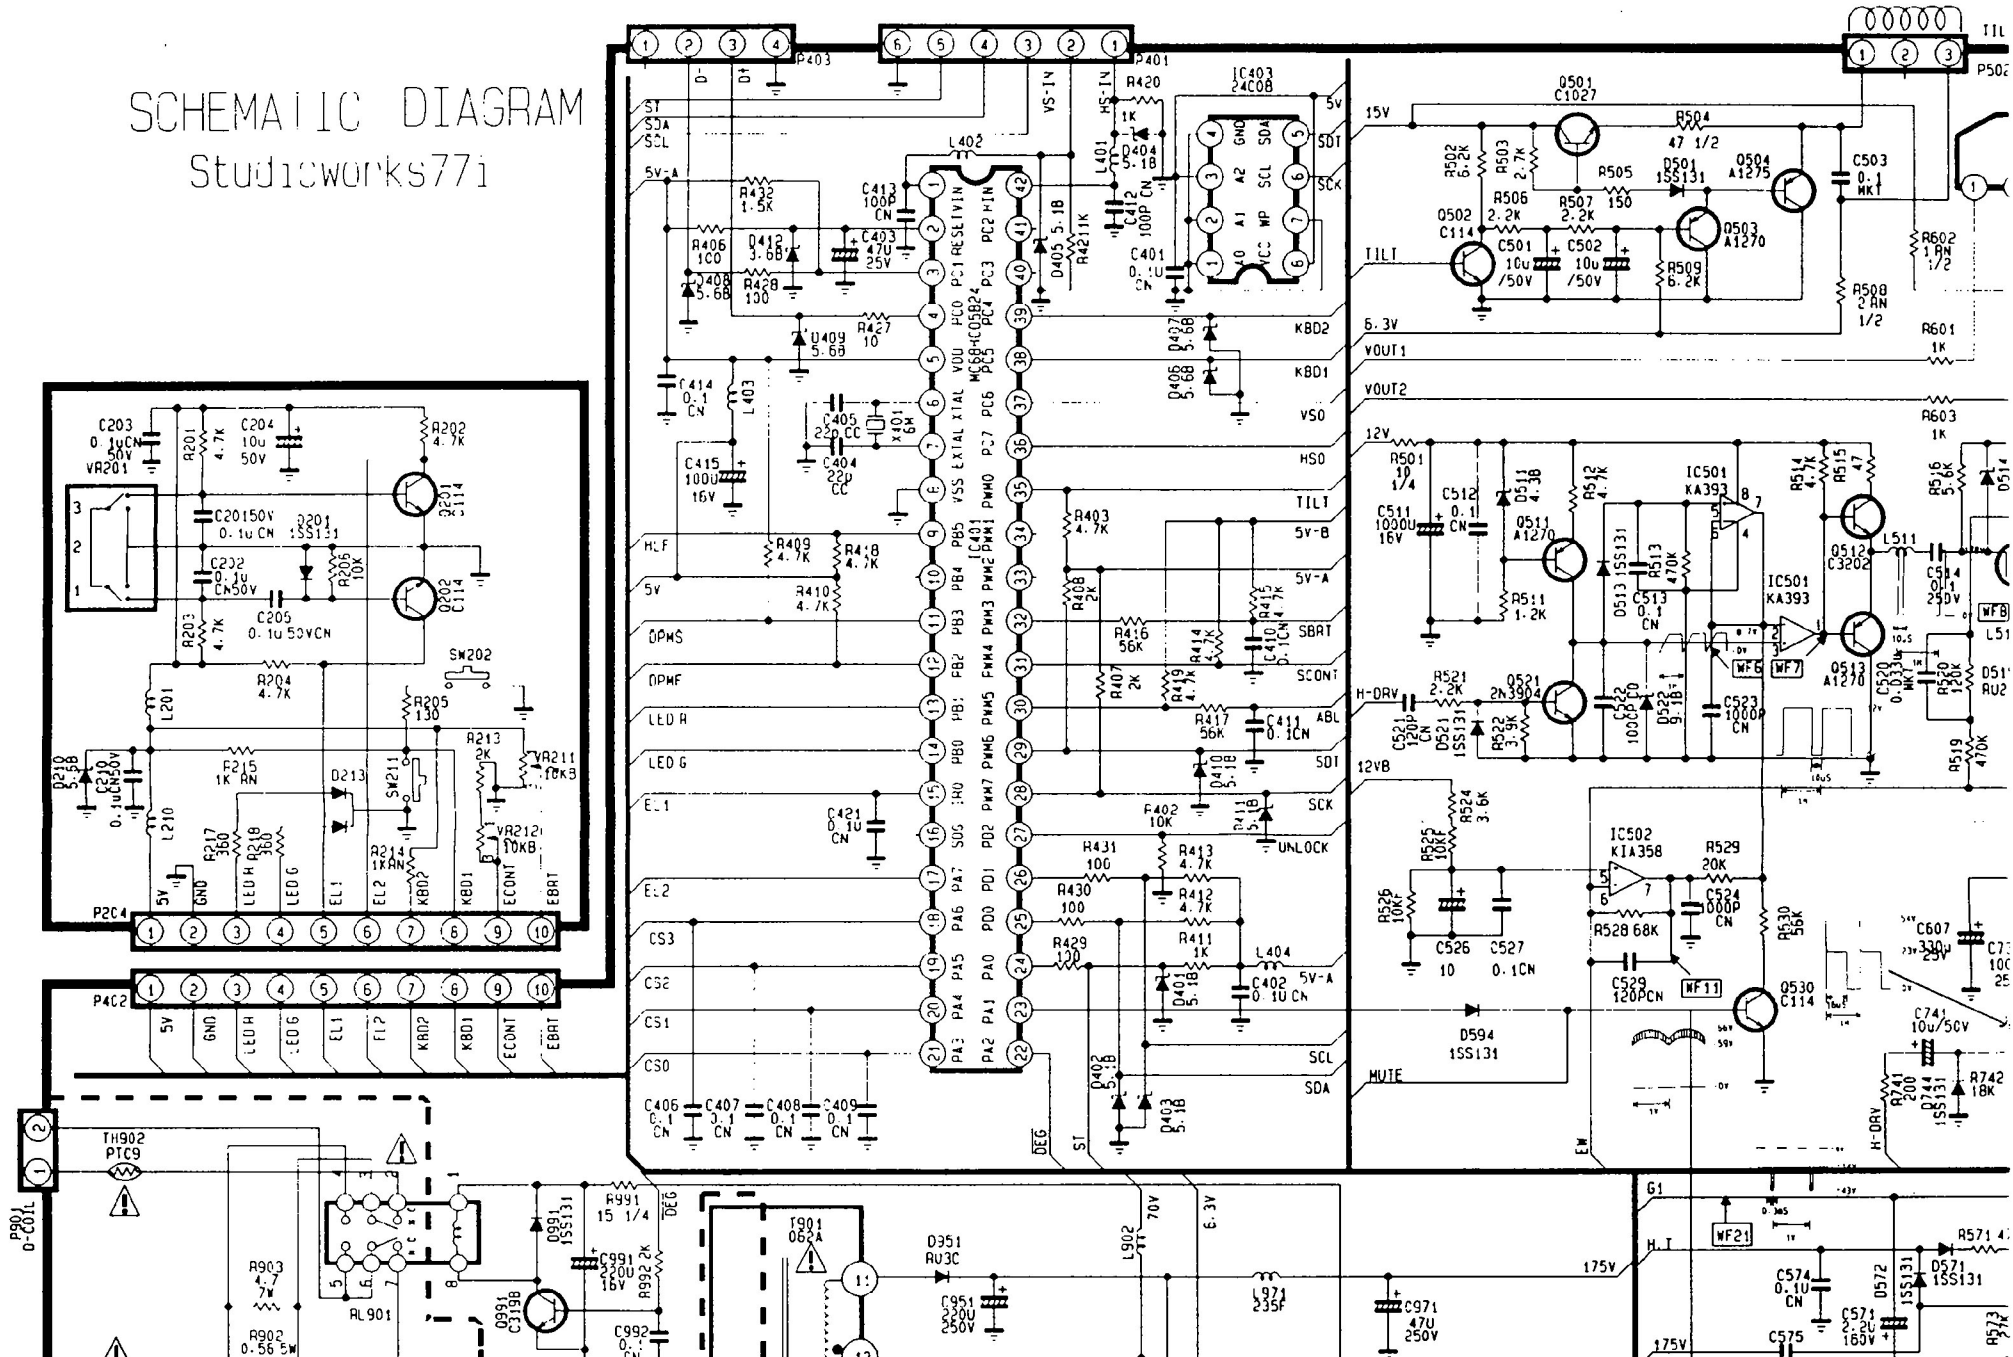

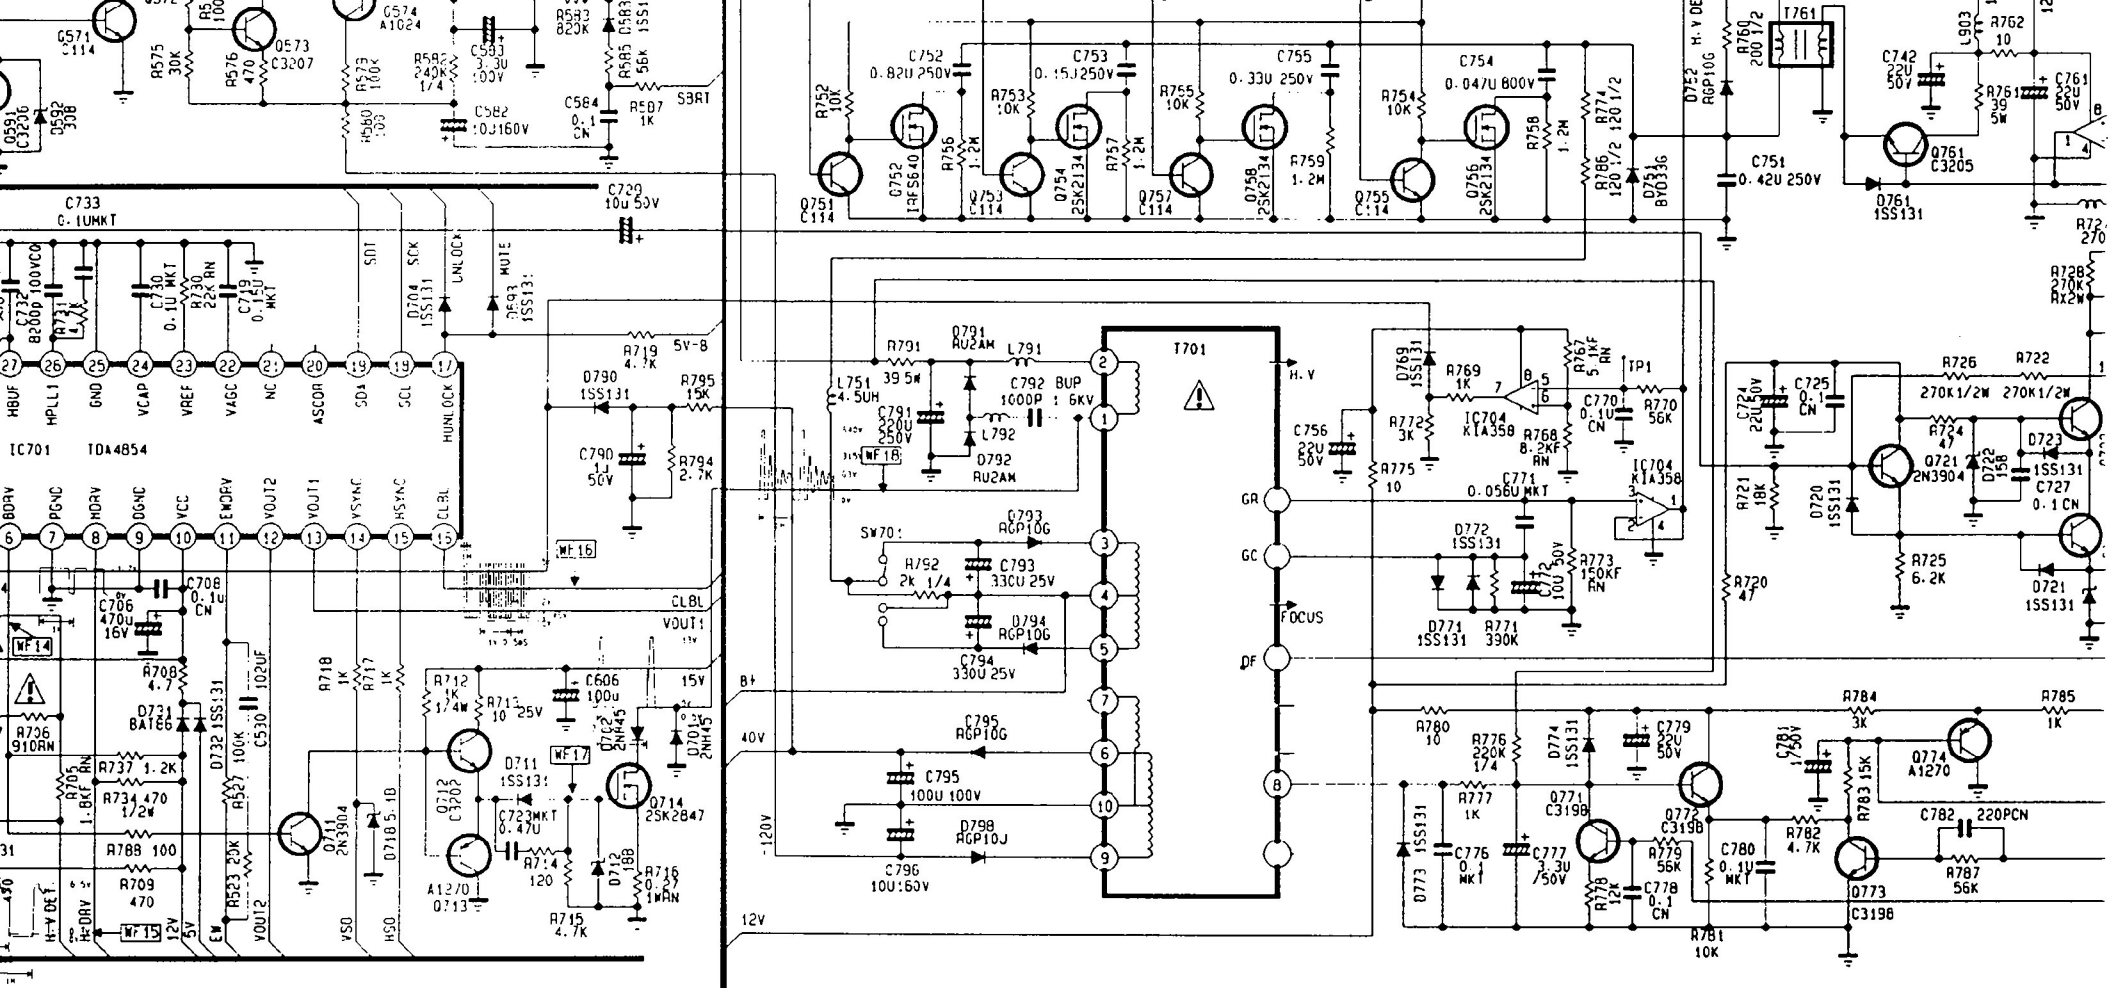


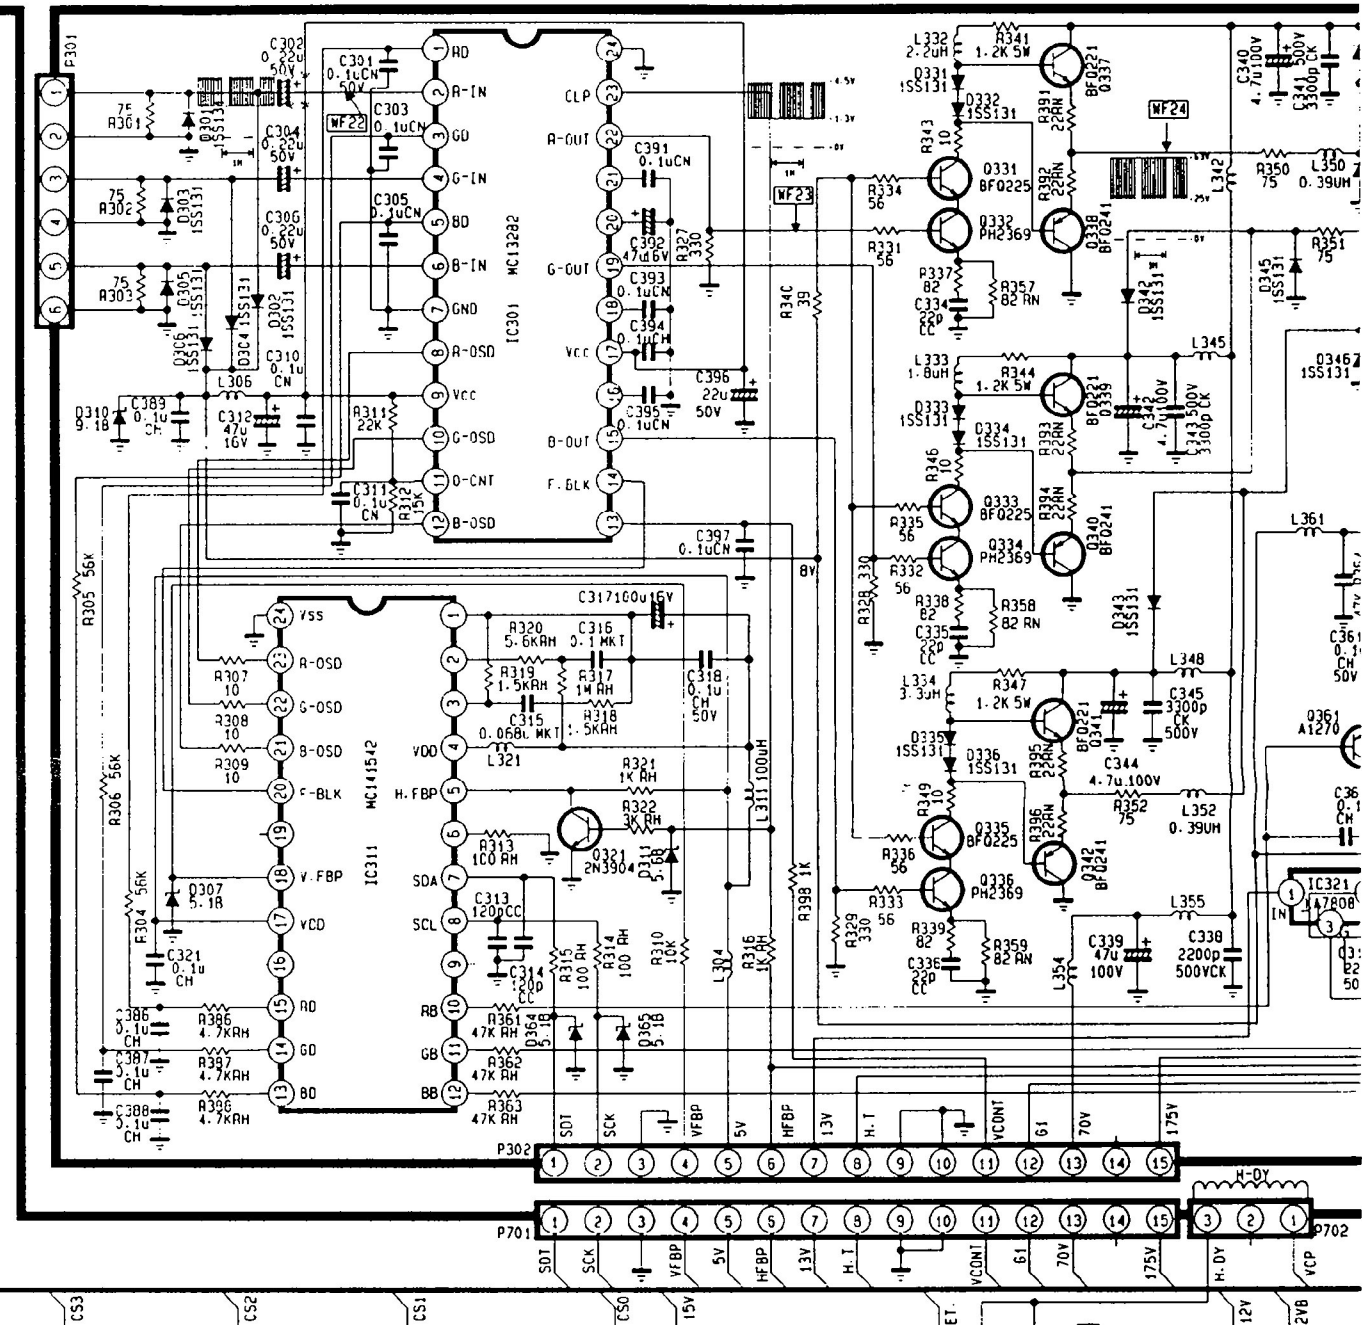

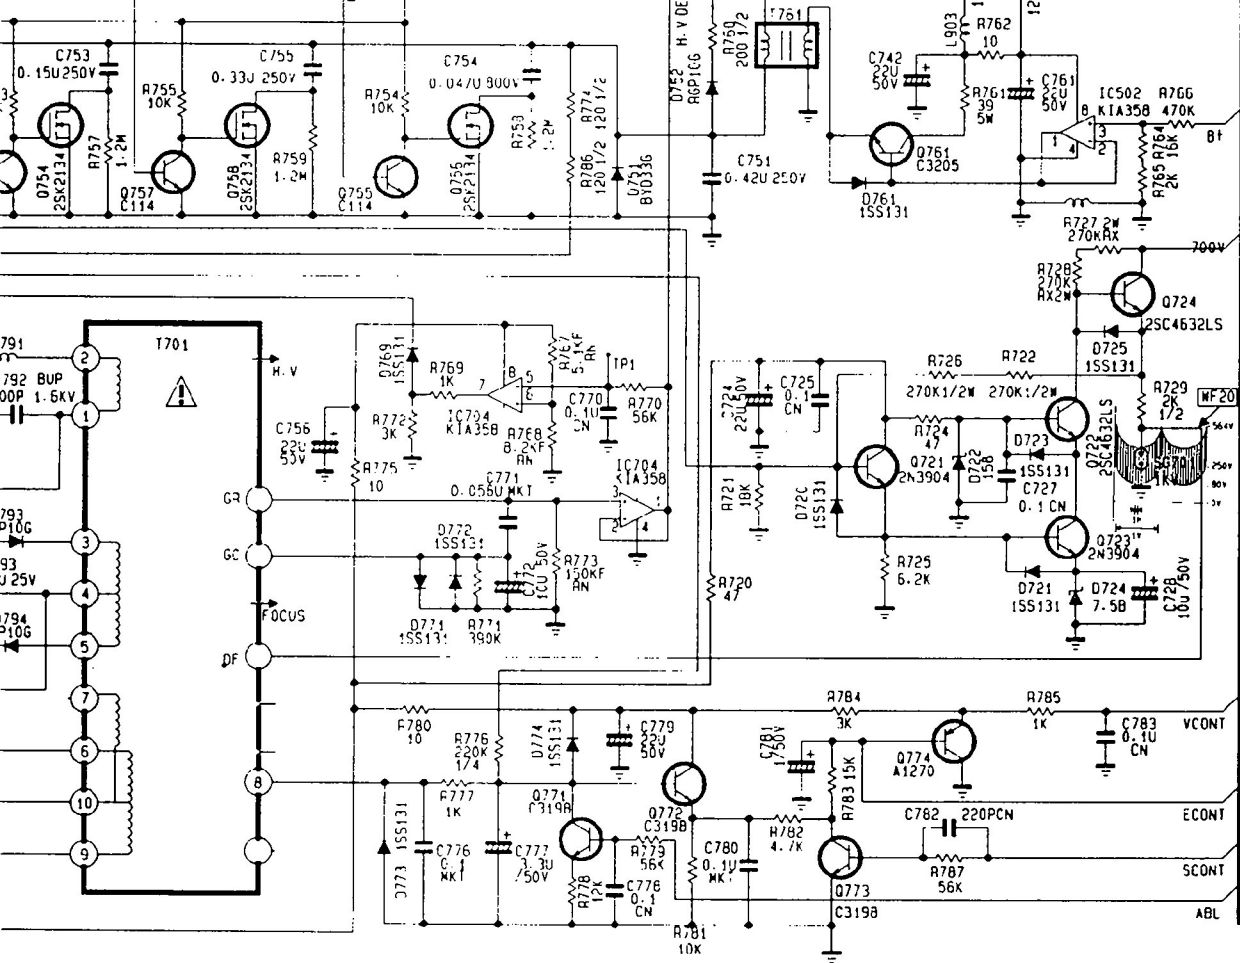


STANDARD INCORPORATES SPECIAL FEATURES
IMPORTANT FOR PROTECTION FROM X-RADIATION.
FIRE AND ELECTRICAL SHOCK HAZARDS. WHEN
SERVICING IT IS ESSENTIAL THAT ONLY
MANUFACTURERS SPECIFIED PARTS BE USED FOR
THE CRITICAL COMPONENTS IN THE  SYMBOL
MARK OF THE SCHEMATIC.


	OPMS	OPMF	WATT
* NORMAL	H	L	NORMAL
SJSPAND STAND-BY	L	L HEATER ON	15W ↓
OFF	L	H HEATER OFF	5W ↓

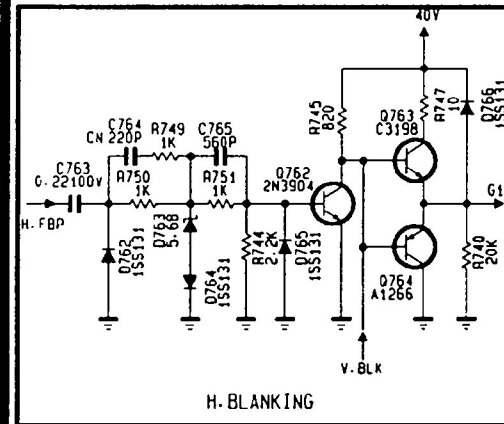

'97.09.29

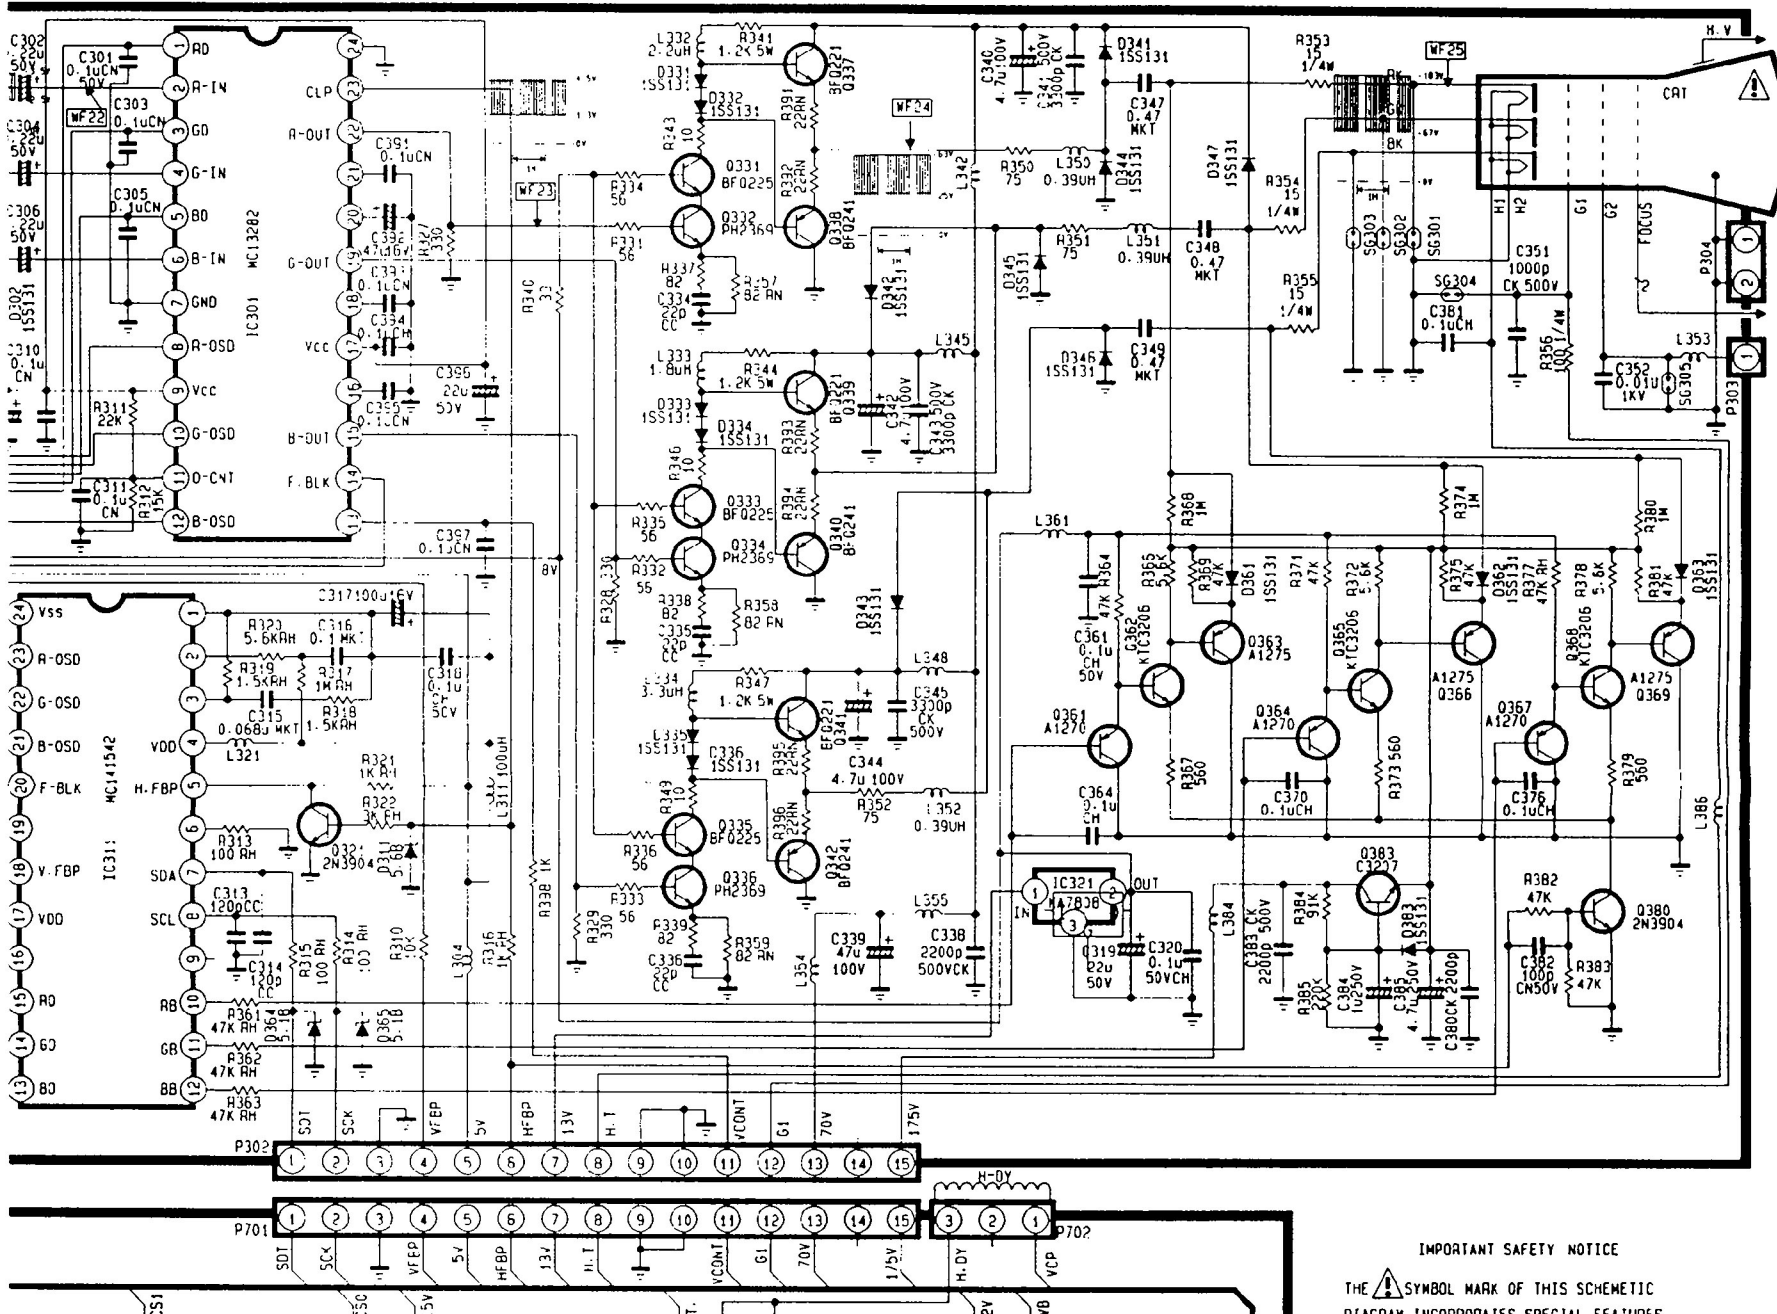

IMPORTANT SAFETY NOTICE

THE  SYMBOL MARK OF THIS SCHEMATIC DIAGRAM INCORPORATES SPECIAL FEATURES