

1995	<b>TOSHIBA</b> Consumer Products	Date: MAR 95
	<b>TECHNICAL BULLETIN</b>	
Product: VCR		Models: M-250, M-250C, M-260C, M-444, M-444C
		No. VCR9506

**Subject:** New regulator block.

**Ref.#** 13A-9501


**Symptom:** No power.

Required part(s):	Location	Part No.	Description
	PW801	BZ680032*	Regulator Block, SOPS-2006

**Corrective Action:** Replace regulator block, PW801 with the new type.

\* The new Regulator Block uses a higher rated transistor.

- Note:**
- 1) The new Regulator Block which has been delivered after Nov. 3rd, 1994 can be identified by the L/N (Lot Number) printed on the yellow label. (see fig. below)
  - 2) The Regulator Block has been modified, even if the date is prior to Nov. 3rd, 1994, if it has a red mark on the upper right side of the yellow label.

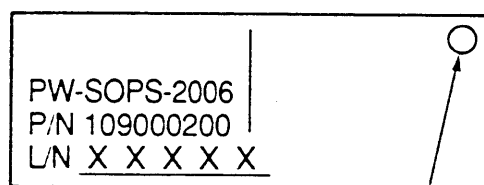

Red Marking

1st and 2nd digit : Date (01 to 31)  
 3rd digit : 1 to 9 : January to September  
                   X : October  
                   Y : November  
                   Z : December  
 4th digit : Year (the last digit)  
 5th digit : Production line